



NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS
LITTLE RIVER UPPER DA. (U) CORPS OF ENGINEERS WALTHAM
MA NEW ENGLAND DIV NOV 79

UNCLASSIFIED

F/G 13/13

NL

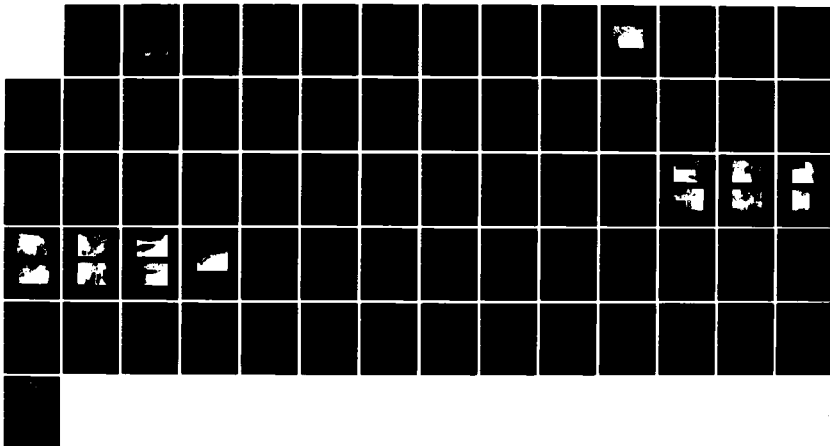

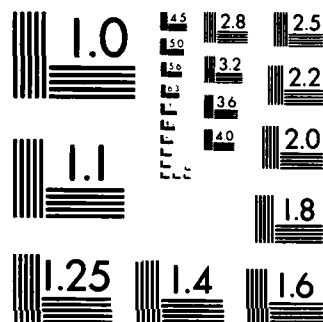

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

AD-A155 372

(2)


ATLANTIC OCEAN
BELFAST, MAINE

LITTLE RIVER UPPER DAM
ME 00289

STATE NO. 5091

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM

Copy available to DTIC does not
permit fully legible reproduction

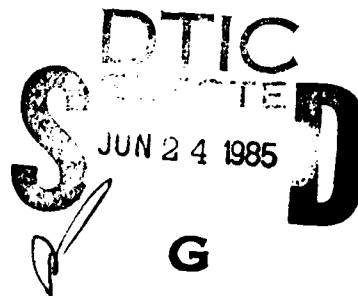

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
WALTHAM, MASS. 02154

NOVEMBER 1979

DISTRIBUTION STATEMENT A
Approved for public release
Distribution is limited

88 06 6 010

DTIC FILE COPY

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER ME 00289	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Little River Upper Dam NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS		5. TYPE OF REPORT & PERIOD COVERED INSPECTION REPORT
7. AUTHOR(s) U.S. ARMY CORPS OF ENGINEERS NEW ENGLAND DIVISION		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS DEPT. OF THE ARMY, CORPS OF ENGINEERS NEW ENGLAND DIVISION, NEDED 424 TRAPELO ROAD, WALTHAM, MA. 02254		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE November 1979
		13. NUMBER OF PAGES 50
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		18a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) APPROVAL FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Cover program reads: Phase I Inspection Report, National Dam Inspection Program; however, the official title of the program is: National Program for Inspection of Non-Federal Dams; use cover date for date of report.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) DAMS, INSPECTION, DAM SAFETY, Atlantic Ocean Belfast Maine Little River		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) The dam is a concrete gravity dam with a hydraulic height of 30 ft., and is 216 ft. long. The dam is in fair condition. It is small in size with a hazard potential of significant. A major breach at top of dam could possibly result in the loss of one life and could cause appreciable property damage.		

DISCLAIMER NOTICE

**THIS DOCUMENT IS BEST QUALITY
PRACTICABLE. THE COPY FURNISHED
TO DTIC CONTAINED A SIGNIFICANT
NUMBER OF PAGES WHICH DO NOT
REPRODUCE LEGIBLY.**



DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
424 TRAPELO ROAD
WALTHAM, MASSACHUSETTS 02154

REPORT TO
ATTENTION
NEDED

JUL 07 1980

Honorable Joseph E. Brennan
Governor of the State of Maine
State Capitol
Augusta, Maine 04330

Dear Governor Brennan.

Inclosed is a copy of the Little River Upper Dam Phase I Inspection Report, which was prepared under the National Program for Inspection of Non-Federal Dams. This report is presented for your use and is based upon a visual inspection, a review of the past performance and a brief hydrological study of the dam. A brief assessment is included at the beginning of the report. I have approved the report and support the findings and recommendations described in Section 7 and ask that you keep me informed of the actions taken to implement them. This follow-up action is a vitally important part of this program.

A copy of this report has been forwarded to the Department of Agriculture cooperating agency for the State of Maine. In addition, a copy of the report has also been furnished the owner, Belfast Water District, 71 Church Street, Belfast, Maine 04915.

Copies of this report will be made available to the public, upon request, by this office under the Freedom of Information Act. In the case of this report the release date will be thirty days from the date of this letter.

I wish to take this opportunity to thank you and the Department of Agriculture for your cooperation in carrying out this program.

Sincerely,

Max B. Scheider
MAX B. SCHEIDER

Colonel, Corps of Engineers
Division Engineer

Incl
As stated

NATIONAL DAM INSPECTION PROGRAM
PHASE I INSPECTION REPORT

Identification No.: ME00289
Name of Dam: Little River Upper Dam
Town: Belfast
County and State: Waldo, Maine
Stream: Little River
Date of Inspection: September 17, 1979

BRIEF ASSESSMENT

Little River Upper Dam is a concrete gravity dam with a hydraulic height of 30 feet, 216 feet long, 3.0 feet wide at the crest, with a vertical upstream face and a downstream face battered at approximately 1H:12V. The central overflow spillway section of the dam is 114 feet long with a slight curvature. At the south abutment there is a concrete training wall. At the north end of the spillway is a concrete intake structure; beyond this, the dam extends to the north abutment. The dam impounds a reservoir with a maximum storage capacity of about 850 acre-feet. The reservoir is .83 mile long with a surface area of about 48 acres and is used as a regulating reservoir for use in water supply for the Town of Belfast.

The dam is in fair condition. Major concerns are: The large ratio of height to average width of the gravity section of the dam, trespassing and erosion on the embankment sections of the dam, trees and brush growing on the embankment sections at the ends of the dam, cracking and spalling of the exposed concrete surfaces, and flexibility and weathering of the plywood cover over the control tower.

Based on small size and significant hazard classification in accordance with Corps guidelines, the test flood ranges from $\frac{1}{2}$ to $\frac{3}{4}$ Probable Maximum Flood (PMF). Because the dam's storage capacity is in the upper range of size classification, $\frac{3}{4}$ PMF will be used as the test flood. The test flood inflow was determined to be 12,800 cfs. The routed test flood outflow for Little River Upper Dam, having a drainage area of 13.7 square miles was determined to be 12,200 cfs at elevation 68.2' MSL, which would overtop the dam by about 3.3 feet. Spillway capacity at top of dam is 5,390 cfs, which is 44 percent of the test flood discharge. A major breach at top of dam could possibly result in the loss of one life and could cause appreciable property damage. (See Section 5.1 f.)

The owner, Belfast Water District, should implement the results of the recommendations and remedial measures given in Sections 7.2 and 7.3 within one year after receipt of this Phase I Inspection Report.



Warren A. Guinan
Project Manager
N.H. P.E. 2339

This Phase I Inspection Report on Little River Upper Dam has been reviewed by the undersigned Review Board members. In our opinion, the reported findings, conclusions, and recommendations are consistent with the Recommended Guidelines for Safety Inspection of Dams, and with good engineering judgment and practice, and is hereby submitted for approval.

Aramast Mahtesian

ARAMAST MAHTESIAN, MEMBER
Geotechnical Engineering Branch
Engineering Division

Carney M. Terzian

CARNEY M. TERZIAN, MEMBER
Design Branch
Engineering Division

Richard J. DiBuono

RICHARD DIBUONO, CHAIRMAN
Water Control Branch
Engineering Division

Accession For	
NTIS GRA&I	<input checked="checked" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Avail and/or	
Dist	Special
A/1	2

APPROVAL RECOMMENDED:

Joe B. Fryar
JOE B. FRYAR
Chief, Engineering Division

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aid in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

TABLE OF CONTENTS

Title	Page
LETTER OF TRANSMITTAL.....	
BRIEF ASSESSMENT.....	
REVIEW BOARD PAGE.....	
PREFACE.....	iv
TABLE OF CONTENTS.....	v
OVERVIEW PHOTO.....	vi
LOCATION MAP.....	vii

REPORT

SECTION

1	PROJECT INFORMATION.....	1-1
	1.1 General.....	1-1
	1.2 Description of Project.....	1-1
	1.3 Pertinent Data.....	1-3
2	ENGINEERING DATA.....	2-1
	2.1 Design.....	2-1
	2.2 Construction.....	2-1
	2.3 Operation.....	2-1
	2.4 Evaluation.....	2-1
3	VISUAL INSPECTION.....	3-1
	3.1 Findings.....	3-1
	3.2 Evaluation.....	3-3
4	OPERATIONAL PROCEDURES.....	4-1
	4.1 Procedures.....	4-1
	4.2 Maintenance of Dam.....	4-1
	4.3 Maintenance of Operating Facilities.....	4-1
	4.4 Description of Any Warning System in Effect.....	4-1
	4.5 Evaluation.....	4-1
5	HYDROLOGY AND HYDRAULIC ANALYSIS.....	5-1
	5.1 Evaluation of Features.....	5-1
6	STRUCTURAL STABILITY.....	6-1
	6.1 Evaluation of Structural Stability.....	6-1
7	ASSESSMENT, RECOMMENDATIONS & REMEDIAL MEASURES.....	7-1
	7.1 Dam Assessment.....	7-1
	7.2 Recommendations.....	7-1
	7.3 Remedial Measures.....	7-2
	7.4 Alternatives.....	7-2

APPENDICES

	Designation
VISUAL INSPECTION CHECK LISTS.....	A
ENGINEERING DATA.....	B
PHOTOGRAPHS.....	C
HYDROLOGY AND HYDRAULIC COMPUTATIONS.....	D
INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS.	E



October, 1979

Figure 1 - Overview of Little River Upper Dam.

NATIONAL DAM INSPECTION PROGRAM
PHASE I INSPECTION REPORT
LITTLE RIVER UPPER DAM

SECTION 1
PROJECT INFORMATION

1.1 General

a. Authority. Public Law 92-367, August 8, 1972 authorized the Secretary of the Army, through the Corps of Engineers, to initiate a National Program of Dam Inspection throughout the United States. The New England Division of the Corps of Engineers has been assigned the responsibility of supervising the inspection of dams within the New England Region. Anderson-Nichols & Company, Inc. has been retained by the New England Division to inspect and report on selected dams in the State of New Hampshire. Authorization and notice to proceed were issued to Anderson-Nichols under a letter of August 28, 1979 from William E. Hodgson, Colonel, Corps of Engineers. Contract No. DACW33-79-C-0050, as changed, has been assigned by the Corps of Engineers for this work.

b. Purpose.

- (1) To perform technical inspection and evaluation of non-Federal dams to identify conditions which threaten the public safety and thus permit correction in a timely manner by non-Federal interests.
- (2) To encourage and prepare the States to initiate quickly effective dam safety programs for non-Federal dams.
- (3) To update, verify and complete the National Inventory of Dams.

1.2 Description of Project

a. Location. Little River Upper Dam, commonly called Upper Dam, is located in the Town of Belfast, Maine; the dam spans Little River approximately 5,600 feet upstream from the river's confluence with the Atlantic Ocean. The dam impounds a pond called Belfast Reservoir Number 2. After discharging at the damsite, Little River flows easterly for a distance of 2,200 feet before it enters Belfast Reservoir Number 1. Little River Upper Dam is shown on the U.S.G.S. Quadrangle Belfast, Maine with coordinates approximately at N 44° 24' 00", W 69° 00' 20", Waldo County, Maine. (See Location Map page vii.)

b. Description of Dam and Appurtenances. Little River Upper Dam is a concrete gravity dam with a hydraulic height of 30 feet, 216 feet long, 3.0 feet wide at the crest, with a vertical upstream face and a downstream face battered at approximately 1H:12V. The central overflow spillway section of the dam is 114 feet long with a slight curvature. At the south end of the overflow spillway section, there is a concrete training wall extending 22.8 feet downstream from the dam. Between this wall and the south abutment earth has been placed. At the south abutment between the training wall and downstream face of the spillway are three concrete steps. Their function is probably to protect the rocky abutment from undermining and also to act as energy dissipators.

Bedrock exposure in the valley downstream of the dam shows that the dam is at least partially founded on bedrock. At the north end of the spillway is a concrete intake structure; beyond this, the dam extends to the north abutment. Earth has been placed against the upstream and downstream faces of the concrete dam near the abutments. A gate, which is not operable and is of unknown size, exists at the north abutment. There are 3 inlet valve operators (unknown type and size) and 2 (6" & 8") outlet pipes from the intake chamber to the downstream channel. There is some evidence of another low-level outlet of an undetermined size and condition approximately 5 feet south of the intake structure under the spillway.

c. Size Classification. Small (hydraulic height - 30 feet; storage - 850 acre-feet) based on height and storage (≥ 25 to < 40 feet; ≥ 50 to < 1000 acre-feet) as given in the Recommended Guidelines for Safety Inspection of Dams.

d. Hazard Classification. Significant hazard. A major break would probably result in the loss of one life and could cause appreciable property damage and loss as a regulating reservoir for use in water supply. (See Section 5.1 f.)

e. Ownership. Presently Little River Upper Dam is owned by Belfast Water District. Information about past ownership was not available.

f. Operator. The current owner and operator of the dam is Belfast Water District, 71 Church Street, Belfast, Maine 04915. Telephone: (207) 338-1200.

g. Purpose of Dam. Reservoir Number 2 is used as a regulating reservoir for use in water supply. Water impounded at Little River Upper Dam can be released through valve chambers into the downstream channel to provide sufficient inflow into Reservoir Number 1 during periods of low water.

h. Design and Construction History. No information regarding the original design or construction of the dam was disclosed.

i. Normal Operating Procedures. No written operational procedures exist for Little River Upper Dam. The gate operating mechanism with 18-inch vcp outlet is rusted and is not in operable condition. Three inlet valve operators (that are reported to be operable), a valve chamber, and two outlet pipes are utilized to put discharge into the downstream channel to provide additional inflow into Reservoir Number 1 as required to meet demands.

1.3 Pertinent Data

a. Drainage Area. The drainage area consists of 13.7 square miles (8,768 acres) of mountainous and partially wooded terrain. The normal pool has a surface area of 48 acres, which constitutes less than 1 percent of the watershed.

b. Discharge at Damsite.

- (1) Outlet works
 - (a) - unknown size gate - not operable
 - (b) - 3 inlet valve operators discharge flow into valve chamber with two outlet pipes:
 - 6-inch diameter at outlet
elevation - 38.7' MSL
 - 8-inch diameter at outlet
elevation - 35.5' MSL
 - (c) - Low-level outlet of an unknown size

- (2) The maximum known discharge at damsite is unknown
- (3) Ungated spillway (principal) capacity @ top of dam elevation - 5,390 cfs @ 64.9' MSL
- (4) Ungated spillway capacity @ test flood elevation - 10,500 cfs @ 68.2' MSL
- (5) Gated spillway capacity @ top of dam elevation - not applicable
- (6) Gated spillway capacity @ test flood elevation - not applicable
- (7) Total spillway capacity @ test flood elevation - 10,500 cfs @ 68.2' MSL
- (8) Total project discharge @ test flood elevation - 12,200 cfs @ 68.2' MSL

c. Elevation. (feet above NGVD of 1929; formerly known as Mean Sea Level (MSL); see (6) below)

- (1) Streambed at centerline of dam - 34.5 (at downstream toe)
- (2) Maximum tailwater - unknown
- (3) Upstream valve chamber invert - unknown

- (4) Recreation Pool - not applicable
- (5) Full flood control pool - not applicable
- (6) Spillway crest - 59 (as shown on U.S.G.S. Quadrangle sheet)
- (7) Design surcharge (original design) - unknown
- (8) Top of dam - 64.9
- (9) Test flood pool - 68.2
- d. Reservoir (miles)
 - (1) Length of maximum pool - .95
 - (2) Length of spillway crest pool - .83
 - (3) Length of flood control pool - not applicable
- e. Storage. (acre-feet)
 - (1) Recreation pool - not applicable
 - (2) Flood control pool - not applicable
 - (3) Spillway crest pool - 480
 - (4) Top of dam - 850
 - (5) Test flood pool - 1045
- f. Reservoir Surface (acres)
 - (1) Recreation pool - not applicable
 - (2) Flood control pool - not applicable
 - (3) Spillway crest - 48
 - (4) Test flood pool - 75
 - (5) Top of dam - 70
- g. Dam
 - (1) Type - concrete gravity
 - (2) Length - 216'
 - (3) Height - 31.5' structural height
 - (4) Top width - 3'

(5) Side slopes - upstream - vertical
- downstream - 1H:12V

(6) Zoning - not applicable

(7) Impervious core - not applicable

(8) Cutoff - unknown

(9) Grout curtain - unknown

h. Diversion and Regulating Tunnel. - not applicable.
(See j. below.)

i. Spillway

(1) Type - concrete ogee overflow

(2) Length of weir - 114'

(3) Crest elevation - 59' MSL

(4) Gates - none

(5) U/S Channel - Reservoir Number 2 completely open

(6) D/S Channel - Little River for about 2,200 feet
before it enters Reservoir Number 1, rocky channel,
very well defined. Herrick Road bridge spans
over the river 200' below the Dam.

j. Regulating Outlets. Three inlet valve operators discharge flow into valve chamber with two outlet pipes:

6-inch diameter @ outlet elevation - 38.7' MSL

8-inch diameter @ outlet elevation - 35.5' MSL

SECTION 2
ENGINEERING DATA

2.1 Design

No design data were disclosed for Little River Upper Dam.

2.2 Construction

No construction records were disclosed.

2.3 Operation

No engineering operational data were obtained.

2.4 Evaluation

a. Availability. No engineering data were available for Little River Upper Dam. Direct contact with the Belfast Water District and a search of the files at the Maine Soil and Water Conservation Commission revealed only a limited amount of data.

b. Adequacy. The final assessments and recommendations of this investigation are based on the visual inspection and the hydrologic and hydraulic calculations.

c. Validity. No engineering data were disclosed to validate.

SECTION 3 VISUAL INSPECTION

3.1 Findings

a. General. Little River Upper Dam is a low run-of-river dam which impounds a reservoir of small size. The watershed above the reservoir is rolling and partially wooded. The downstream area is rolling and partially wooded.

b. Dam. Little River Upper Dam is a concrete ogee shaped gravity dam 30 feet high (hydraulic), 216 feet long, and 3.0 feet wide at the crest, with a vertical upstream face and a downstream face battered at 1H:12V. (See Appendix C - Figures 2 and 3.) The central overflow spillway section of the dam is 114 feet long with a slight curved alignment. At the south end of the overflow spillway section there is a concrete training wall extending 22.8 feet downstream from the dam. Between this wall and the south abutment earth has been placed against the upstream and downstream faces of the concrete dam. At the north end of the spillway, there is a concrete intake structure, beyond which the dam extends to the north abutment. (See Appendix C - Figure 4.) Earth has been placed against the upstream and downstream faces of the concrete dam near the abutment. The ends of the dam where the concrete wall is flanked by earthfill on both the upstream and downstream sides are referred to as embankment sections in subsequent sections of this report and in the checklist. Bedrock exposures on the south side of the valley downstream of the dam show that that end of the dam is founded on bedrock. (See Appendix C - Figure 5.) Soil cover and brush growing on the north side of the valley make it impossible to determine visually whether that end of the dam is founded on bedrock.

The visible portion of the concrete spillway and training walls show some evidence of surface deterioration and cracking. A substantial portion of the spillway and training walls have been repaired with gunite in the past. Several areas of the gunite patching are cracked and spalled from the original concrete surface. (See Appendix C - Figure 6.) Numerous hairline cracks in the spillway face and training walls exhibit efflorescence. The crest and downstream face of the concrete spillway are water stained. The downstream toe of the concrete spillway has eroded exposing the coarse aggregate.

Trespassing has been considerable on the crest and downstream and upstream slopes of the embankment section at the south end of the dam, to the extent that many patches are bare of vegetation. Major erosion has occurred on the abutment side of the training wall that extends downstream from the south end of the

overflow section of the dam. Brush and small trees are growing on the upstream slope. (See Appendix C - Figures 7 & 8.)

Minor trespassing has occurred on the crest and upstream and downstream slopes of the embankment section at the north end of the dam. Brush and small trees are growing on the crest and upstream and downstream slopes.

c. Appurtenant Structures. At the north end of the overflow spillway there is a 9.7-foot by 8.3-foot concrete control tower (intake structure) constructed integrally with the spillway and north end of the concrete non-overflow section of the dam. (See Appendix C - Figure 9.) The control tower contains 3 inlet valves (unknown size and type) for varied elevations. There are two discharge pipes approximately 30 feet down from the top of the tower to discharge water from the intake chamber to the downstream channel. (See Appendix C - Figure 10.) The Belfast Water Department Assistant Superintendent reported that the 3 inlet valves are in operable condition. Visual inspection revealed that there is only minor seepage into the chamber from the upstream side. There are numerous hairline cracks on the downstream face of the control tower exhibiting efflorescence. (See Appendix C - Figure 6.) Access to the interior of the chamber is through two trap doors on the top of the chamber, one steel and one plywood. (See Appendix C - Figure 4.) The steel door is surface rusted and the plywood door is weathered. The plywood door is unreinforced and is quite flexible. Continued weathering of the plywood will lead to a condition that will no longer support the weight of the operator or other persons and may fail.

Approximately 2 feet to the north of the control tower (intake structure) there is an intermediate level outlet gate operating mechanism. (See Appendix C - Figure 11.) The shaft and steel bearing attached to the upstream face of the dam are coated with gunite. The gate operating mechanism has not been maintained and does not appear operable. The Belfast Water Department Assistant Superintendent reports that the gate has not been operated in many years. An 18-inch clay tile pipe discharges from the downstream face of the dam in line with the gate operating mechanism. (See Appendix C - Figure 6.) Water is discharging from the 18-inch clay tile line at an estimated rate of 15 to 30 gpm.

d. Reservoir Area. The watershed above the reservoir is rolling and partially wooded. (See Appendix C - Figure 12.) No structures were observed on the shore of the reservoir. No evidence of significant sedimentation in the reservoir was observed.

e. Downstream Channel. The channel downstream of the dam appears to be on bedrock. The south bank of the channel is bedrock, but the left bank is soil. Trees and brush overhang the left side of the channel. Herrick Road bridge crosses the channel 200 feet downstream from the dam. (See Appendix C - Figures 13 & 14.)

3.2 Evaluation

Based on the visual inspection, Little River Upper Dam is in fair condition.

Trespassing on the embankment sections at the south and north abutments has caused major erosion on the abutment side of the downstream training wall at the south end of the overflow section of the dam and loss of vegetation elsewhere. Continued trespassing and erosion may endanger the embankment sections and the training wall. Trees and brush are growing on the embankment sections at the ends of the dam. If a tree blows over and pulls out its roots, or if a tree dies and its roots rot, seepage and erosion problems may result.

Trees and brush overhanging the downstream channel between the dam and the highway bridge could contribute to blockage of the channel and the opening under the highway bridge during floodflow.

Hairline cracks and spalled areas of the exposed concrete face could continue to deteriorate and lead to instability of the dam. Frost action in the cracks and rough areas of concrete will speed up at the deterioration process.

The plywood cover over the control tower will pose a dangerous condition to people walking on the cover if left uncorrected.

SECTION 4 OPERATIONAL PROCEDURES

4.1 Procedures

No written operational procedures exist for Little River Upper Dam. Three intake valve operators are kept operable to provide sufficient inflow into Reservoir Number 1 during periods of low water.

4.2 Maintenance of Dam

The owner, Belfast Water District, is responsible for the maintenance of dam.

4.3 Maintenance and Operating Facilities

No formal maintenance was disclosed. The intermediate level gate mechanism is inoperable. The three intake valve operating mechanisms are kept in operating condition.

4.4 Description of Any Warning System in Effect

No written warning system exists for the dam.

4.5 Evaluation

Formal operational and maintenance procedures should be developed to ensure that problems that are encountered can be remedied within a reasonable period of time.

SECTION 5 HYDROLOGIC/HYDRAULIC

5.1 Evaluation of Features

a. General. Little River Upper Dam is a concrete, ogee shaped gravity dam which impounds a reservoir with a maximum storage capacity of 850 acre-feet. The dam contains runoff from a 13.7-square mile drainage area consisting of mountainous predominately wooded terrain. A gate of unknown size is located at the north abutment. The gate mechanism is rusted and not operable. The gate was designed to control discharge through an 18-inch diameter outlet pipe. There is also a valve chamber control tower at the north abutment. It has three inlet valve operators (size and type unknown) and two outlet pipes (6-inch and 8-inch respectively). The valves are in operating condition. There is evidence of another low-level outlet of an undetermined size and condition approximately 5 feet south of the intake structure, under the spillway. The reservoir level is primarily controlled by the spillway which is located at the center of the dam.

b. Design Data. No hydrologic or hydraulic design data were found.

c. Experience Data. No hydrologic or hydraulic experience data were disclosed.

d. Visual Observations. At the time of the inspection, no visual evidence was noted of damage to the structure caused by overtopping.

e. Test Flood Analysis. Little River Upper Dam is classified as being small in size having a hydraulic height of 30 feet and a maximum storage capacity of 850 acre-feet. The dam was determined to have a significant hazard classification. Using the Recommended Guidelines for Safety Inspection of Dams, test flood range is $\frac{1}{4}$ to $\frac{1}{2}$ the Probable Maximum Flood (PMF).

Because the dam maximum storage capacity is in the upper range of small size classification, the test flood was determined to be $\frac{1}{2}$ the Probable Maximum Flood (PMF).

Using the $\frac{1}{2}$ PMF, the test flood inflow for Little River Upper Dam, having a drainage area of 13.7 square miles, was determined to be 12,800 cfs. After reservoir routing, the test flood discharge was determined to be 12,200 cfs. This value was obtained using the COE guide curves with the 'mountainous' characteristics. The test flood analysis indicates that the dam embankment would be overtopped by approximately 3.3 feet during the test flood conditions. The water depth discharging through the principal spillway would be 9.2 feet and would amount to 10,500 cfs. Spillway capacity at top of dam (64.9' MSL) is 5,390 cfs, which is 44 percent of test flood discharge. Flow through two outlet pipes (6" and 8" in diameter) from the valve chamber is insignificant. Because the gate is

inoperable, the overtopping analysis was calculated assuming no discharge through the 18" outlet pipe or through the larger low-level outlet under the spillway.

f. Dam Failure Analysis. The impact of failure of the dam at the top of dam was assessed using the Guidance for Estimating Downstream Dam Failure hydrographs issued by the Corps of Engineers. The analysis covered the reach extending from the dam to Reservoir Number 1, a distance of 2,200 feet along Little River. A major breach of Little River Upper Dam would result in a breach discharge of about 20,160 cfs. The discharge immediately prior to a breach would be 5,300 cfs or maximum spillway capacity. This antecedent discharge would pass low flow through the Herrick Road bridge with a depth of about 12 feet. A breach would raise the water surface about 16.6 feet causing overtopping of the road and possible structural damage. The antecedent discharge from the Upper Dam, would cause the Lower Dam to have a depth of about 7 feet over the spillway, without considering any storage effects of the reservoir. A breach wave would cause an increase of almost 7 feet which could cause damage to the dam and the water facilities for the Town of Belfast. There could possibly be a loss of life to the dam tender at the Lower Dam. The breach could also cause loss of a regulating reservoir for use in water supply and could cause appreciable property damage. Therefore, Little River Upper Dam was classified Significant Hazard.

SECTION 6 STRUCTURAL STABILITY

6.1 Evaluation of Structural Stability

a. Visual Observations. The most significant visual observation about the concrete section of this dam is that the ratio of its height to average width appears to be larger than the values commonly associated with gravity dams having conventional factors of safety. (Because the reservoir was filled with water, it was not practical to measure the width at various elevations during the inspection.)

Trespassing on the embankment sections at the south and north abutments has caused major erosion on the abutment side of the downstream training wall at the south end of the overflow section of the dam and loss of vegetation elsewhere. Continued trespassing and erosion may endanger the embankment sections and the training walls.

Hairline cracks and spalled areas of the exposed concrete surface could continue to deteriorate and lead to instability of the dam. Frost action in the cracks and rough areas of the concrete will speed up the process.

The plywood cover over the control tower will pose a dangerous condition to people walking on the cover if left uncorrected.

Trees and brush are growing on the embankment sections at the ends of the dam. If a tree blows over and pulls out its roots, or if a tree dies and its roots rot, seepage and erosion problems may result.

b. Design and Construction Data. No design and construction data are available for this dam.

c. Operating Records. No engineering operational records were obtained.

d. Post-Construction Changes. No information regarding post-construction changes were disclosed.

e. Seismic Stability. This dam is located in Seismic Zone 2 and, in accordance with the Phase I guidelines, does not warrant seismic analysis.

SECTION 7
ASSESSMENT, RECOMMENDATIONS, AND REMEDIAL MEASURES

7.1 Dam Assessment

a. Condition. The visual inspection indicates that Little River Upper Dam is in fair condition. The major concerns with respect to the integrity of the dam, if left uncorrected, are:

- (1) Large ratio of height to average width of the gravity section of the dam.
- (2) Trespassing and erosion on the embankment sections of the dam.
- (3) Trees and brush growing on the embankment sections at the ends of the dam.
- (4) Cracking and spalling of the exposed concrete surfaces.
- (5) Flexibility and weathering of the plywood cover over the control tower.

b. Adequacy of Information. The information available is such that the assessment of this dam must be based primarily on the results of the visual inspection. There is not enough information about the geometry of the cross section and the foundation conditions to assess the stability of the gravity section of the dam against overturning or sliding.

c. Urgency. The recommendations made in 7.2 and 7.3 should be implemented by the owner within one year after receipt of this Phase I inspection report.

d. Need for Additional Investigation. Additional investigation is needed to assess the stability of the gravity section of the dam against sliding or overturning.

7.2 Recommendations

The owner should engage a Registered Professional Engineer to:

- (1) Evaluate the stability of the dam against sliding and overturning and to design remedial measures, if needed.
- (2) Design procedures for and inspect the clearing of trees and brush from the embankment sections of the dam.

- (3) Design repairs for the erosion that has occurred on the embankment sections of the dam.
- (4) Design repairs to the cracked and spalled areas of the concrete surfaces.
- (5) Repair or replace plywood cover to the control tower.
- (6) Repair or replace 18" clay tile pipe.

The owner should carry out the recommendations made by the Engineer.

7.3 Remedial Measures

a. Operating and Maintenance Procedures. The owner should:

- (1) Prevent trespassing on the embankment section of the dam.
- (2) Repair or replace plywood cover.
- (3) Clear trees and brush for a distance of 25 feet on either side of the downstream channel between the dam and the highway bridge.
- (4) Visually inspect the dam and appurtenant structures once a month.
- (5) Engage a Registered Professional Engineer to make a comprehensive technical inspection of the dam once every year.
- (6) Establish a surveillance program for use during and immediately after heavy rainfall, and also a downstream warning program to follow in case of emergency conditions.

7.4 Alternatives

None.

APPENDIX A
VISUAL INSPECTION CHECKLIST

VISUAL INSPECTION CHECKLIST
PARTY ORGANIZATION

PROJECT Little River Upper Dam, ME

DATE Sept. 17, 1979

TIME 1500

WEATHER Sunny, cool

W.S. ELEV U.S. DN.S.
 59' msl 36.5' msl

PARTY:

- | | |
|----------------------------------|-----------------------------------|
| 1. <u>Warren Guinan (ANCo)</u> | 6. <u>Janusz Czyzowski (ANCo)</u> |
| 2. <u>Stephen Gilman (ANCo)</u> | 7. <u>Ronald Hirschfeld (GEI)</u> |
| 3. <u>Leslie Williams (ANCo)</u> | 8. _____ |
| 4. <u>John Regan (ANCo)</u> | 9. _____ |
| 5. <u>Terry Sapp (ANCo)</u> | 10. _____ |

PROJECT FEATURE	INSPECTED BY	REMARKS
1. <u>Hydrology/Hydraulics</u>	<u>L. Williams/J. Czyzowski</u>	_____
2. <u>Structural Stability</u>	<u>S. Gilman</u>	_____
3. <u>Soils and Geology</u>	<u>R. Hirschfeld</u>	_____
4. _____	_____	_____
5. _____	_____	_____
6. _____	_____	_____
7. _____	_____	_____
8. _____	_____	_____
9. _____	_____	_____
10. _____	_____	_____

PERIODIC INSPECTION CHECKLIST

PROJECT Little River Upper Dam, ME DATE Sept. 17, 1979
 PROJECT FEATURE Dam Embankment NAME _____
 DISCIPLINE _____ NAME _____

AREA EVALUATED	CONDITION
<u>DAM EMBANKMENT</u>	<u>EMBANKMENT FROM END OF CONCRETE SECTION TO SOUTH ABUTMENT</u>
Crest Elevation	
Current Pool Elevation	
Maximum Impoundment to Date	
Surface Cracks	None observed
Pavement Condition	No pavement
Movement or Settlement of Crest	None observed
Lateral Movement	None observed
Vertical Alignment	Good
Horizontal Alignment	Good
Condition at Abutment and at Concrete Structures	Major erosion next to downstream training wall at south end of concrete section.
Indications of Movement of Structural Items on Slopes	None observed
Trespassing on Slopes	Trespassing on embankment along upstream and downstream sides of corewall.
Sloughing or Erosion of Slopes or Abutments	See "Condition at Abutment..." above.
Rock Slope Protection - Riprap Failures	No riprap
Unusual Movement or Cracking at or Near Toe	None observed
Unusual Embankment or Downstream Seepage	None observed
Piping or Boils	None observed
Foundation Drainage Features	None observed
Toe Drains	None observed
Instrumentation System	None observed
Vegetation	Some trees and brush on embankment, some areas bare of vegetation.

PERIODIC INSPECTION CHECKLIST

PROJECT Little River Upper Dam, ME DATE September 17, 1979
 PROJECT FEATURE Control Tower NAME _____
 DISCIPLINE _____ NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - CONTROL TOWER</u>	
a. Concrete and Structural	
General Condition	Fair, numerous hairline cracks in outside and inside surface. Surface of gate chamber has been faced with gunite.
Condition of Joints	Not visible.
Spalling	Numerous areas of spalling of gunite surfaces.
Visible Reinforcing	None.
Rusting or Staining of Concrete	Yes, at embedded items. Substantial staining at 8"x6" gate chamber outlets.
Any Seepage or Efflorescence	Yes, considerable efflorescence at hairline cracks.
Joint Alignment	Good. No indication of movement.
Unusual Seepage or Leaks in Gate Chamber	Minor leakage into chamber.
Cracks	Numerous hairline cracks.
Rusting or Corrosion of Steel	
b. Mechanical and Electrical	
Gate Chamber	3 inlet valve operators-reported operable.
Float Wells	2 outlet pipes.
Crane Hoist	
Elevator	
Hydraulic System	
Service Gates	
Emergency Gates	Lower level 18" clay tile pipe (VCP) - gate operating mechanism poor condition seeping ± GPD. No lubrication, rusted, no indication of recent operation.
Lightning Protection System	Ass't Supt. indicated no operation that he could remember.
Emergency Power System	
Wiring and Lighting System	

PERIODIC INSPECTION CHECKLIST

PROJECT Little River Upper Dam, ME DATE Sept. 17, 1979
 PROJECT FEATURE Outlet Structure & Channel NAME _____
 DISCIPLINE _____ NAME _____

AREA EVALUATED	CONDITION
<p><u>OUTLET WORKS - OUTLET STRUCTURE AND OUTLET CHANNEL</u></p> <p>General Condition of Concrete</p> <p>Rust or Staining</p> <p>Spalling</p> <p>Erosion or Cavitation</p> <p>Visible Reinforcing</p> <p>Any Seepage or Efflorescence</p> <p>Condition at Joints</p> <p>Drain holes</p> <p>Channel</p> <p>Loose Rock or Trees Overhanging Channel</p> <p>Condition of Discharge Channel</p>	<p>One drain hole (?) discharging water in concrete abutment (outlet works) section at north end of overflow spillway.</p> <p>Some trees overhanging channel.</p> <p>Good.</p>

PERIODIC INSPECTION CHECKLIST

PROJECT Little River Upper Dam, ME DATE Sept. 17, 1979

PROJECT FEATURE Spillway Weir NAME _____

DISCIPLINE _____ NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - SPILLWAY WEIR, APPROACH AND DISCHARGE CHANNELS</u>	
a. Approach Channel	
General Condition	Good.
Loose Rock Overhanging Channel	None.
Trees Overhanging Channel	Some trees overhanging channel.
Floor of Approach Channel	Not visible beneath water surface.
b. Weir and Training Walls	
General Condition of Concrete	(Training walls - fair, numerous hairline cracks in surface - surface has been gunited.
Rust or Staining	(Weir - good. Minor surface erosion and spalling of gunite.
Spalling	Only water stain visible
Any Visible Reinforcing	Numerous gunited areas are surface spalling
Any Seepage or Efflorescence	None.
Drain Holes	Majority of hairline cracks on D/S face Shows efflorescence.
c. Discharge Channel	One drain hole (1"-3") discharging water from training wall downstream of right end of spillway section. (Only dripping seep)
General Condition	Good.
Loose Rock Overhanging Channel	None.
Trees Overhanging Channel	Some trees overhanging channel.
Floor of Channel	Bedrock.
Other Obstructions	Highway bridge immediately downstream of dam.

PROJECT Little River Upper Dam, Me.

DATE Sept. 17, 1979

PROJECT FEATURE Reservoir

NAME J. Czyzowski

AREA EVALUATED	REMARKS
Stability of Shoreline	Good
Sedimentation	No evidence
Changes in Watershed Runoff Potential	None
Upstream Hazards	None
Downstream Hazards	Herrick Road Bridge; Reservoir Number 1
Alert Facilities	None
Hydrometeorological Gages	None
Operational & Maintenance Regulations	No written recommendations were found.

APPENDIX B
ENGINEERING DATA

APPLICATION FOR DAM REGISTRATION

Dam Registration Number 5091
Date Received DEC 15 1975
Fee Enclosed 10.00 P82
Quad Sheet Name Belfast
Quad Sheet Number M-9-NE
+ - - - - -

Location:

County: Waldo
Municipality: Quasi-Municipal
Belfast Water District
Name of Dam: Upper Reservoir Dam
Name of Impoundment: Reservoir #2

Ownership:

Name of Owner: Belfast Water District
Address of Owner: 71 Church Street
Belfast, Maine 04915
Telephone Number: 338-1200

Name of Agent: _____
(if different from Owner)

Address: _____

Telephone Number: _____


Description of Dam

Type: Arched Concrete
Construction Material: Concrete
(Concrete, wood, earth)
Year Originally built: 1913 Year last major repair: 1970
Height: 25 ft. Width: 230 ft.
Spillway type: open Spillway Width: 90 ft.
58 1/2 acres
Impounding Capacity: 157,000,000 gallons Drawdown available: 20 ft.
(Acres-Foot) (feet)
Fish Passage available?: no Installed Electrical Generating Cap: --
Purposes for which stored water is used: Public drinking supply


Most recent inspection by Qualified Engineer (Date): August 1972

Name and Address of Engineer: Dale E. Caruthers - (Deceased)
Masonic Building, Gorham, Maine 04038


Other Permits applicable: -----

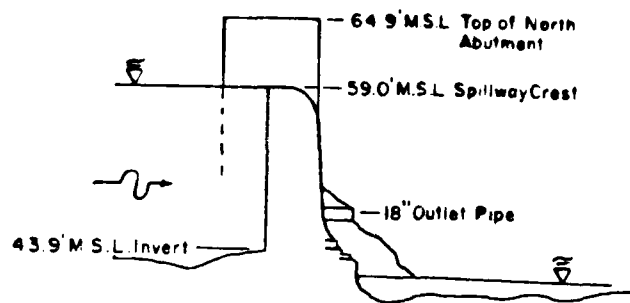


SECTION A-A

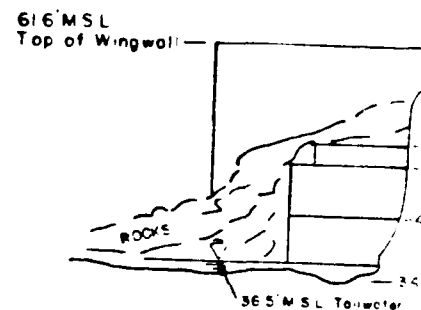


SECTION B-B

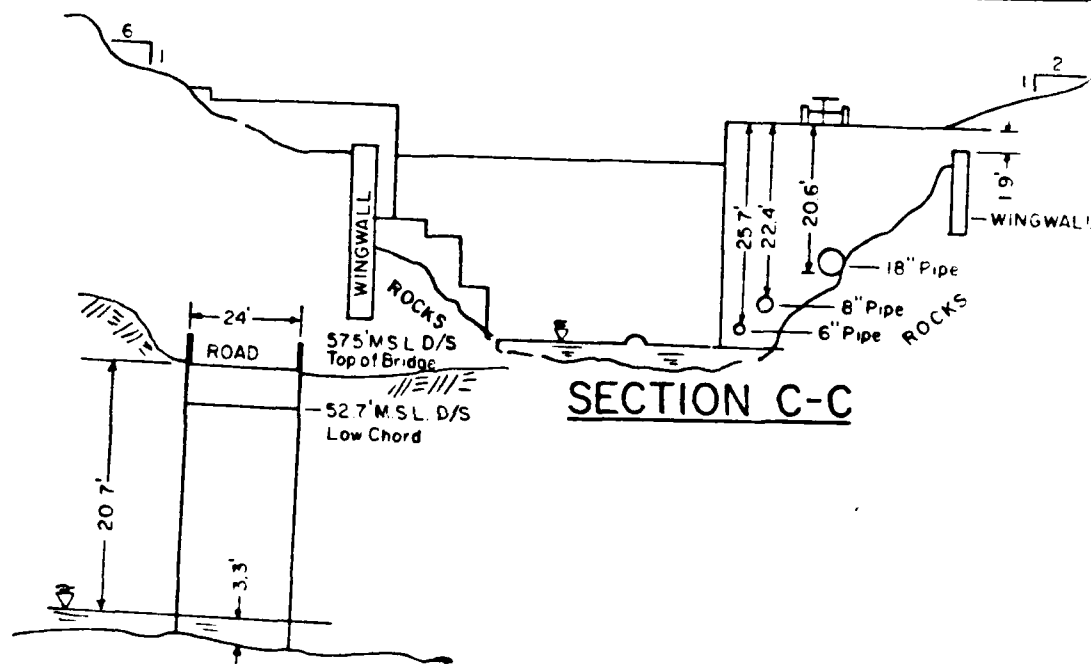



SECTION C-C

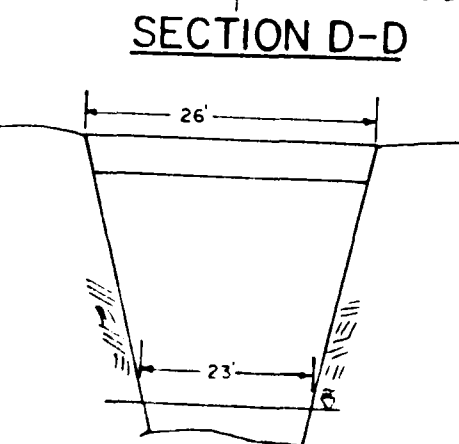

SECTION D-D

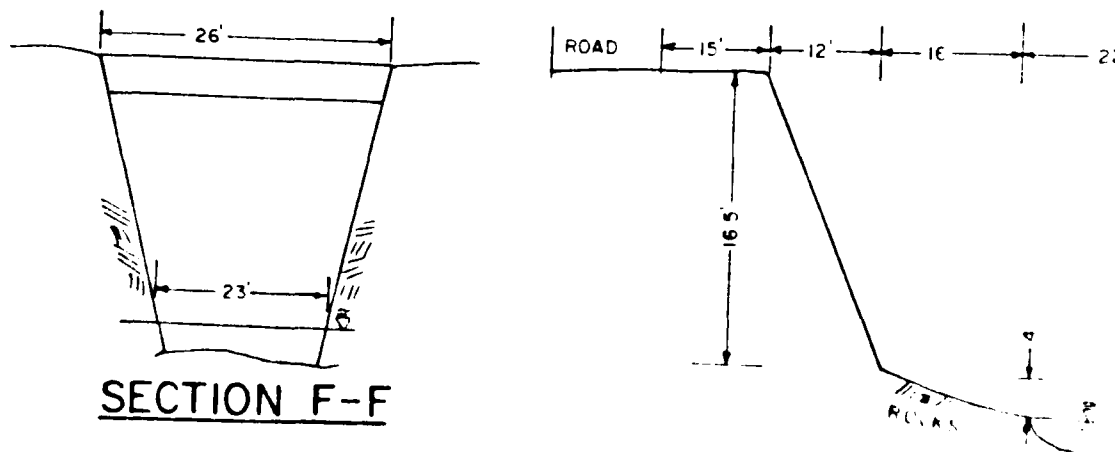


SECTION F-F

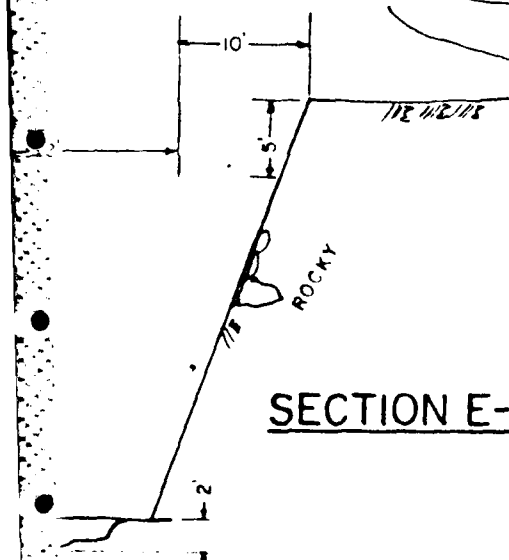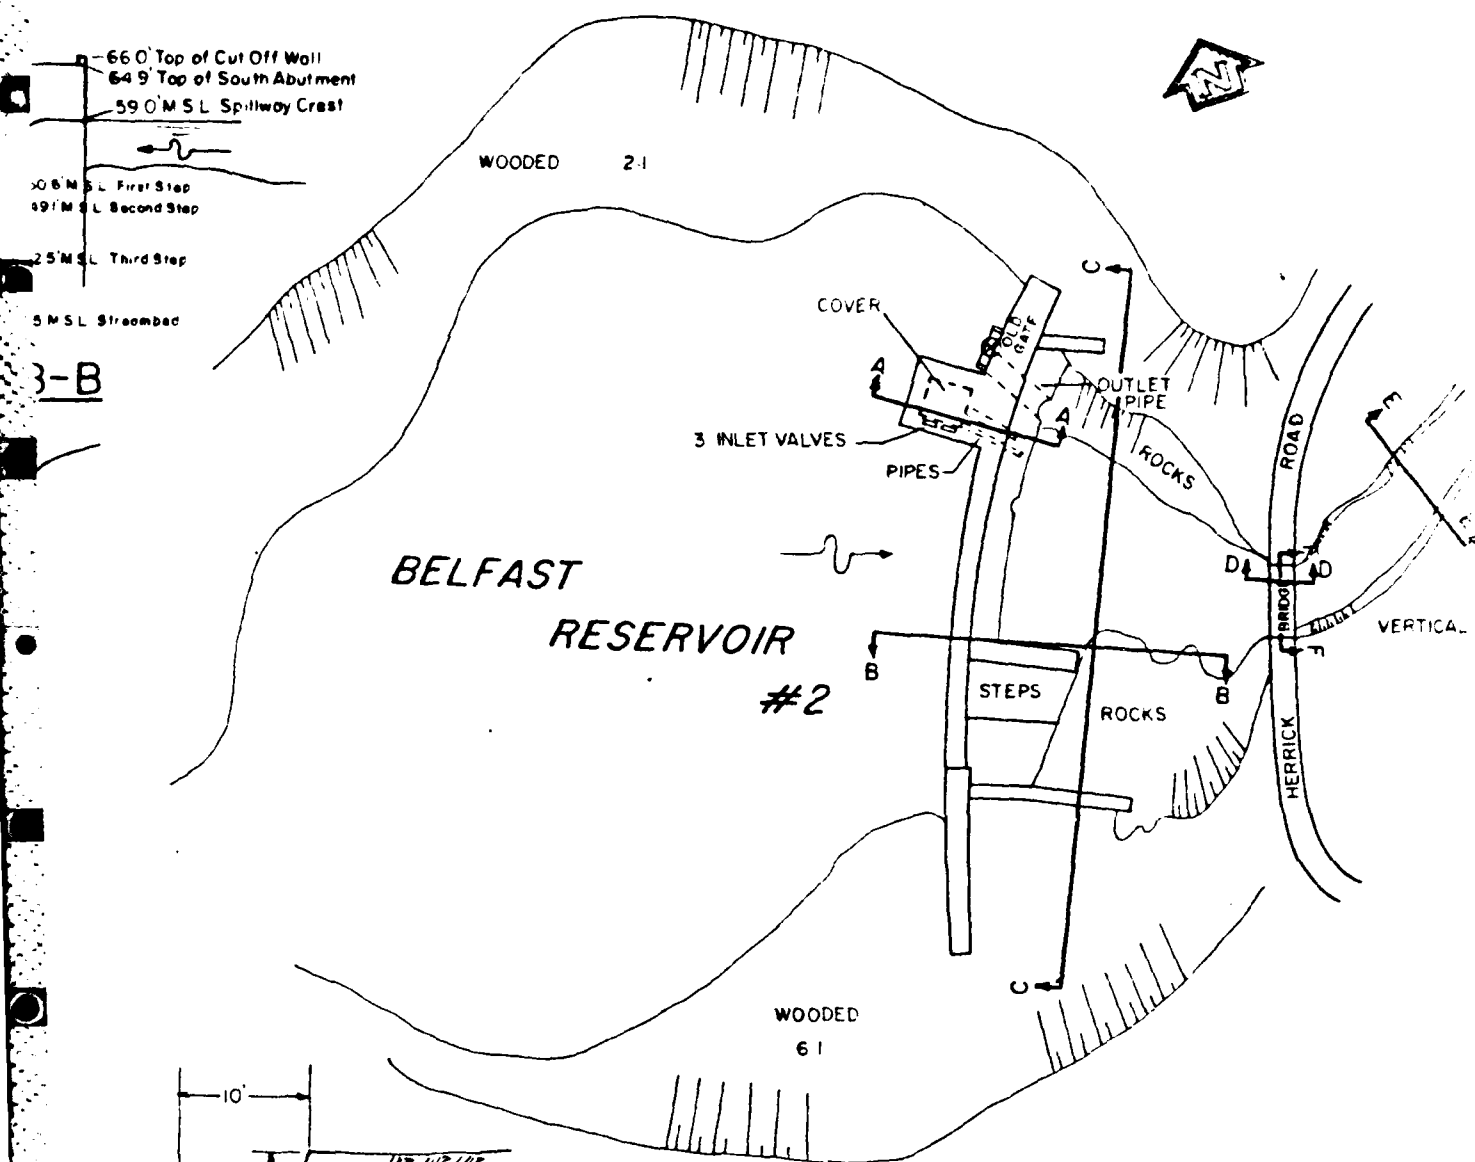


NOTE: ALL ELEVATIONS ARE BASED ON SPILLWAY CREST ASSUMED ELEVATION OF 59' MSL DATUM (NGVD)

Anderson-Nichols & Co., Inc.		U.S. ARMY ENGINEER DIV NEW ENGLAND	
CONCORD		CORPS OF ENGINEERS	
NEW HAMPSHIRE		WALTHAM, MA	
NATIONAL PROGRAM OF INSPECTION OF NON-FED DAMS			
LITTLE RIVER UPPER DAM			
LITTLE RIVER		MAINE	
		SCALE NOT TO SCALE	
		DATE NOVEMBER 1970	

APPENDIX C
PHOTOGRAPHS

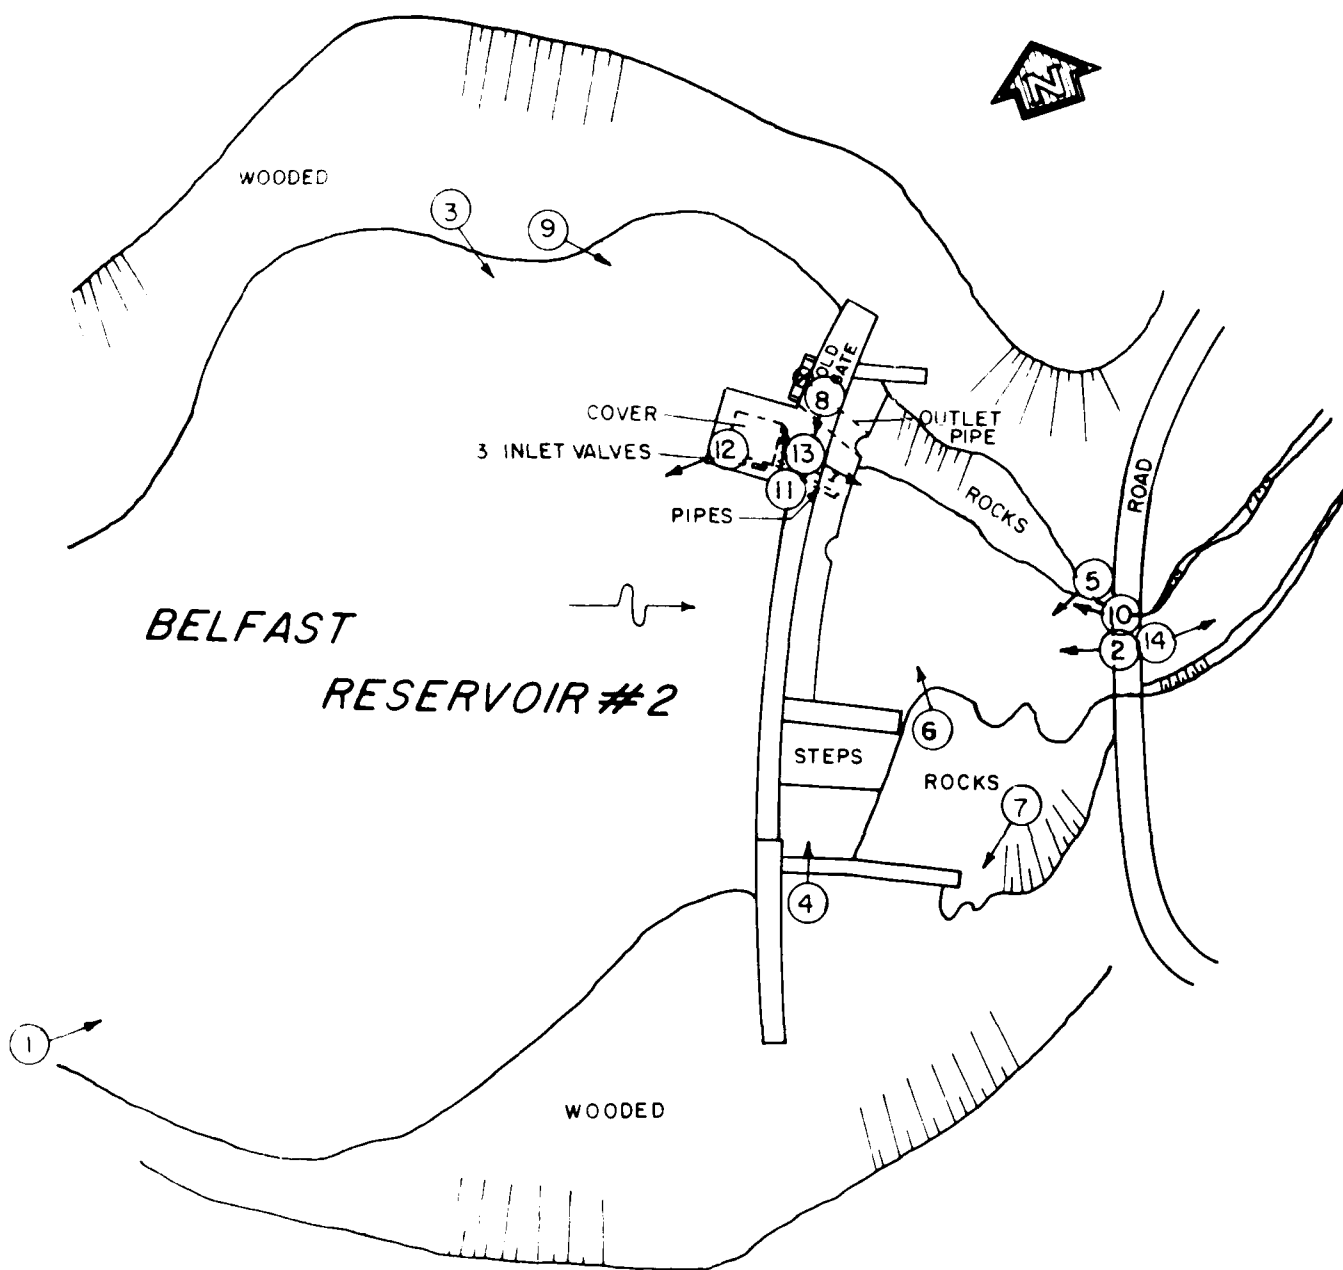

Anderson-Nichols & Co., Inc.		U.S. ARMY ENGINEER DIV. NEW ENGLAND	
CONCORD		CORPS OF ENGINEERS	
NEW HAMPSHIRE		WALTHAM, MA	
NATIONAL PROGRAM OF INSPECTION OF NON-FED. DAMS			
PHOTO INDEX			
LITTLE RIVER		MAINE	
		SCALE NOT TO SCALE	
		DATE NOVEMBER 1979	

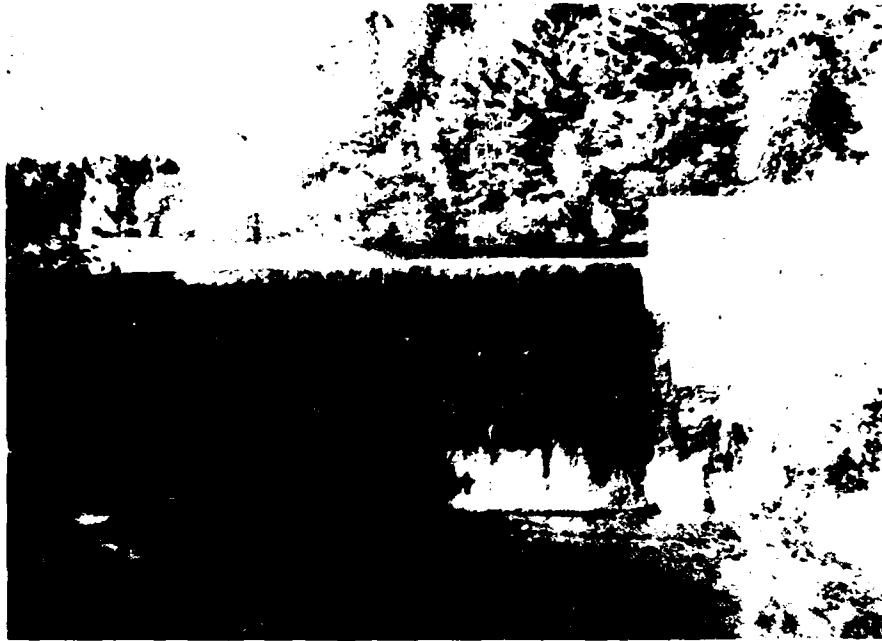

September 17, 1979
Figure 2 - Looking at downstream face of Little
River Upper Dam.



September 17, 1979
Figure 3 - View of upstream face of Little River
Upper Dam.




September 17, 1979
Figure 4 - Looking at north abutment of dam.



September 17, 1979
Figure 5 - Downstream face of south abutment.



September 17, 1979
 Figure 6 - Looking at 18-inch outlet pipe at
 north abutment of the dam.

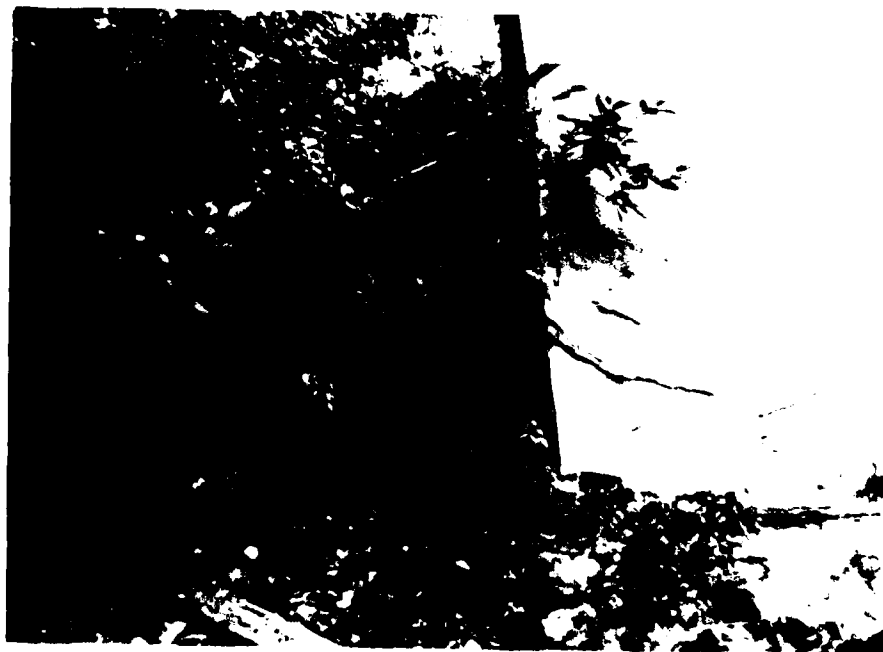

September 17, 1979
 Figure 7 - View of major erosion on south end of
 training wall at south abutment.



September 17, 1979
Figure 8 - Looking across crest from north abutment
of the dam.



September 17, 1979
Figure 9 - Upstream face of the north abutment. View
of control tower and gate mechanism.



September 17, 1979
Figure 10 - View of two discharge pipes from the
intake structure.



September 17, 1979
Figure 11 - View of gate mechanism at the north
abutment.



September 17, 1979
Figure 12 - Looking upstream at the reservoir from the
top of the north abutment.



September 17, 1979
Figure 13 - Herrick Road Bridge 200' downstream of
the dam.



September 17, 1979
Figure 14 - Looking at the downstream channel from
the top of Herrick Road Bridge.


APPENDIX D
HYDROLOGIC AND HYDRAULIC COMPUTATIONS

UPSTREAM DRAINAGE AREA

DOWNSTREAM
HAZARD AREA

(SEE DETAIL LOWER LEFT)

DAM LOCATION

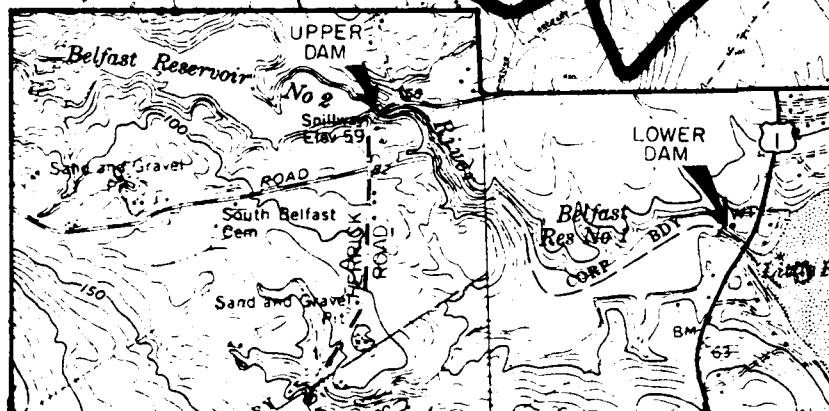

NATIONAL PROGRAM OF INSPECTION
OF NON-FED DAMS

LITTLE RIVER UPPER DAM
BELFAST, MAINE

REGIONAL VICINITY MAP

NOVEMBER 1979

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
WALTHAM, MASSACHUSETTS

ANTHONY-NICHOLS & CO., INC.

CONCORD, NH

SCALE IN MILES



MAP BASED ON U.S.G.S. 7.5 MINUTE QUADRANGLE
SHEETS. BELFAST, ME, 1960. REVISED 1973.
SEARSPORT, ME., 1973. LINCOLNVILLE, ME., 1960,
REVISED 1973. ISLESBORO, ME., 1973.

JOB NO. 3273-16 LITTLE RIVER - UPPER DAMJARES 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29
IN. SCALEBREACH ANALYSISDETERMINE EFFECTS OF BREACH AT TOP OF DAM
TO CLASSIFY DOWNSTREAM HAZARD CONDITIONS.

$$Q_F = \frac{8}{27} W L \sqrt{g} Y_0^{3/2}$$

 $W_B = \text{BREACH WIDTH}$ $g = 32.2 \text{ FT/SEC}^2$ $Y_0 = \text{POOL ELEV.} - \frac{1}{2} \text{ RIVER BED}$

$$W_B = 216 \times .4 = 86$$

ASSUME BREACH OCCURS

$$Y_0 = 64.9 - 39.2 = 25.7$$

AT TOP OF THE DAM - 64.9 FTMSL

$$Q = 18,839 \text{ CFS}$$

 Q THROUGH SPILLWAY OTHER THAN WHERE IT IS BREACH.

$$L = 114 - 86 = 28 \text{ FT}$$

$$H = 64.9 - 59 = 5.9$$

$$C = 3.3$$

$$Q = C \cdot L \cdot H^{3/2} = 1,324 \text{ CFS}$$

$$\underline{\text{TOTAL BREACH } Q = 20,160 \text{ CFS}}$$

ANTECEDENT DISCHARGE (SPILLWAY CAPACITY AT TOP OF
DAM)

$$Q = 3.3 \times 114 \times 5.9^{3/2} = \underline{\underline{5290 \text{ CFS}}}$$

D-2

JOB NO.

3273-16

JARES IN. SCALE 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29

LITTLE RIVER - UPPER DAM

BREACH ANALYSIS - CONT'D

REACH # 1

USE A TYPICAL CROSS SECTION ALONG THE DOWNSTREAM
REACH FROM THE DAM TO THE HERRICK ROAD BRIDGE FOR A
DISTANCE OF 200 FEET

DEVELOP A RATING CURVE FOR THIS SECTION BY

USE OF MANNING'S EQUATION: $Q = \frac{1.49}{n} \cdot A \cdot R^{2/3} \cdot S^{1/2}$ *

$$n = .05$$

$$S = .005$$

DEPTH [FT]	AREA	WPER	Q [CFS]
0	0	0	0
4	154.5	49.1	694
8	378.2	68.1	2469
12	670.8	87.1	5439
16	1030.8	105.6	9770
20	1468.	130.7	15265
24	2008.	158.	22658
28	2652.	185.2	32369

*

'n' - ROUGHNESS COEFFICIENT

A - AREA OF SECTION IN SQUARE FEET

R - A/WETTED PERIMETER

S - SLOPE OF REACH

ANDERSON + NICHOLS - CICO

DATE: 09-26-77


CRIMINAL BY: [unclear]
CHIEF EL 87: [unclear]


JOB # 3212-16

LITTLE RIVER - UPPER DAM

REACH # 1

X-SECTION OF DOWNSTREAM CHANNEL (ENTRANCE BRIDGE AND DAM)

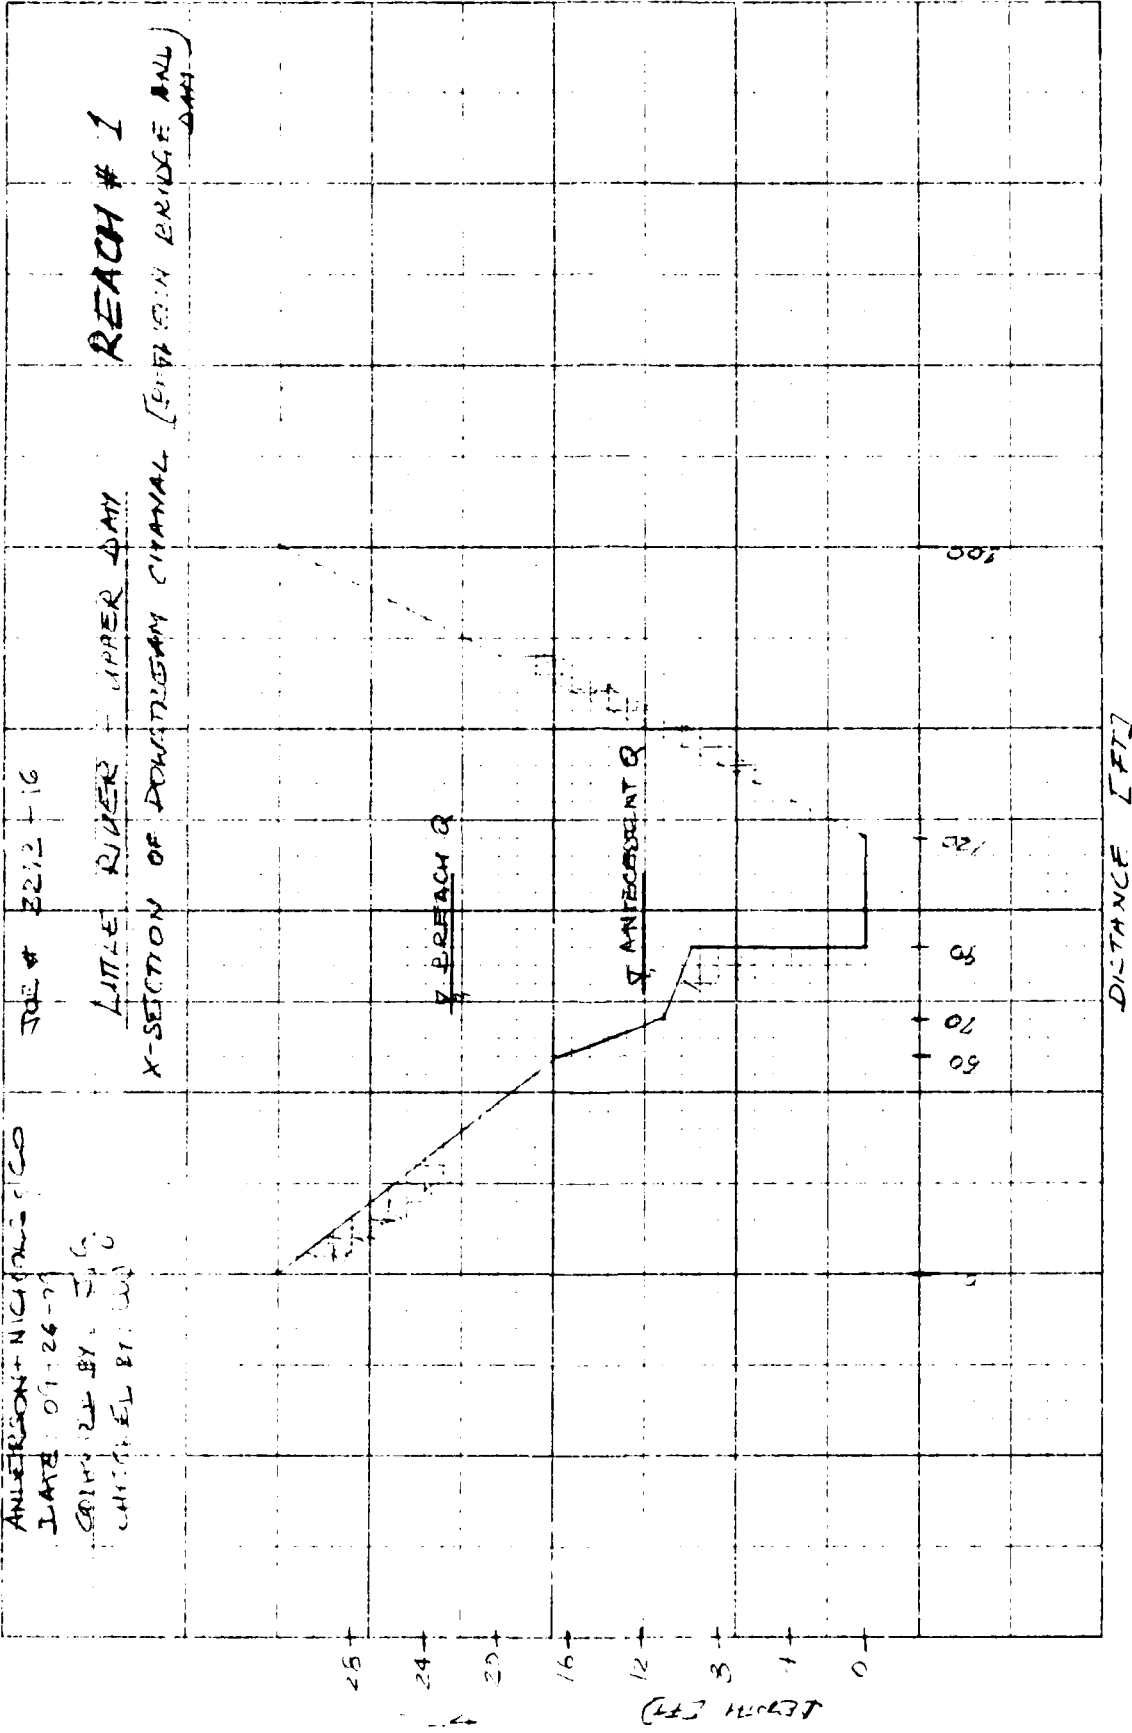

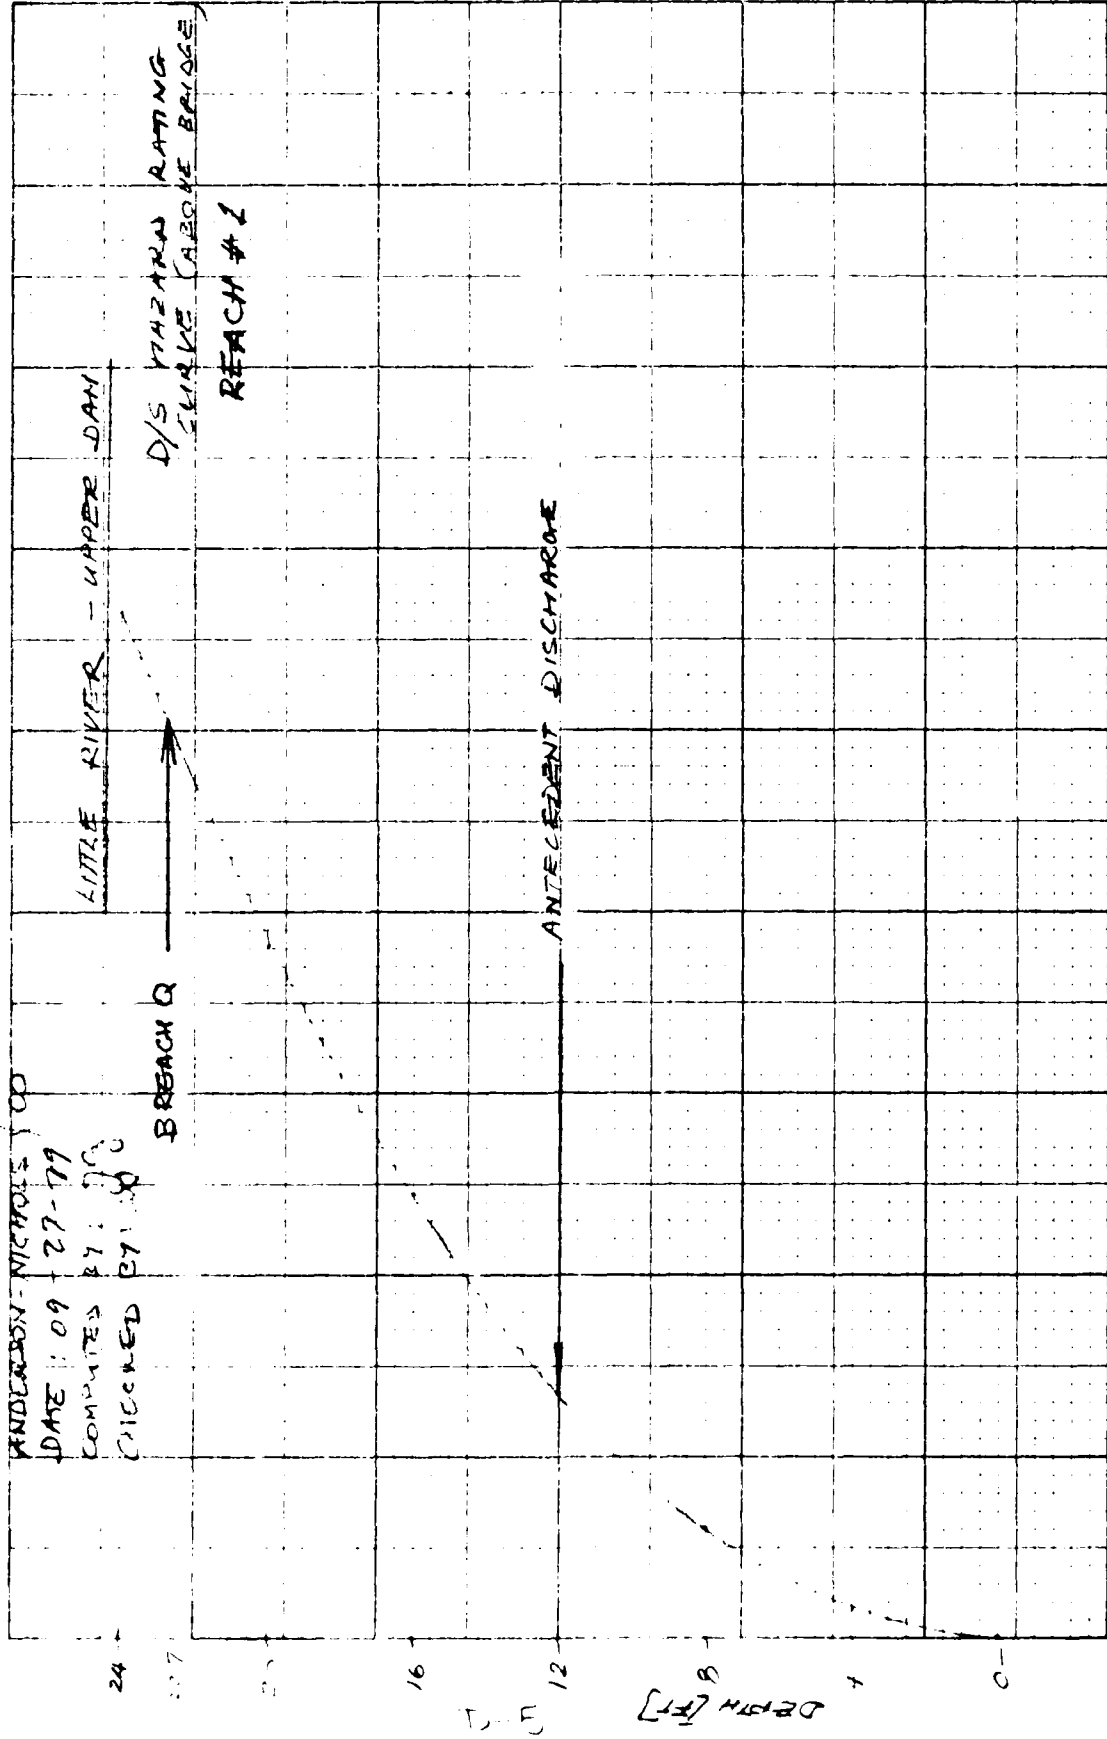

JOB NO. 3273-16

0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29

LITTLE RIVER - UPPER DAM

BREACH ANALYSIS - CONT'D

DEVELOP A RATING CURVE FOR THE X-SECTION ALONG HERRICK ROAD BRIDGE 200' DOWNSTREAM THE DAM.

LOW FLOW -	CALCULATED USING	MANNING'S EQUATION	
ELEV.	AREA	WPER	Q [CFS]
33.5	0	0	0
36.7	74.4	29.4	696
39.9	150.4	35.8	2055
43.1	228.	42.2	3795
46.5	307.2	48.7	5807
49.5	388	55.	8034
52.7	470.4	61.5	10440

ROUGHNESS COEFF.
 CONCR WALL .015
 BOTTOM .035

$C = .0125$

PRESSURE & WEIR FLOW

C VALUE CALCULATION FOR PRESSURE FLOW:

$$K_f = \frac{29.1 \times h^2 \times L}{R^{4/3}}$$

$$K_f = \frac{29.1 \times .03^2 \times 24}{5.27^{4/3}} = .067$$

$$1.10 + .067 = 1.167$$

$$K = \frac{1}{C^2} = 1.167 \quad C = .92$$

L = LENGTH OF BRIDGE
 = 24'

n = for CONCRETE BRIDGE
 WITH CHANN BOTTOM - 0.03

R - HYDRAULIC RADIUS

INTAKE AND EXIT LOSSES =
 = 1.10

JOB NO. 3273 - 16

JARES IN. SCALE 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29

LITTLE RIVER - UPPER DAM

BREACH ANALYSIS - CONT'D

PRESSURE FLOW - AREA - 470. SQFT C - .93

ELEV.	H.	$Q = AC \sqrt{2gH}$ [CFS]
57.5	14.4	13,331
60.0	16.9	14,424
65.0	21.9	16,435
70.0	26.9	18,183


WEIR FLOW - C = 2.8

[FT MSL] ELEV.	[FT] L	[FT] H	$Q = CLH^{3/2}$ [CFS]
57.5		0	
60.0	110	2.5	1217
65.0	130	7.5	7476
70.0	170	12.5	21036

SUMMARY -


ELEV. [FT MSL]	Q [CFS]
33.5	0
36.7	696
39.9	2055
43.1	3795
46.5	5807
49.5	8034
52.7	10410
57.5	13,331
60.0	15,641
65.0	23,911
70.0	39,219

D-7

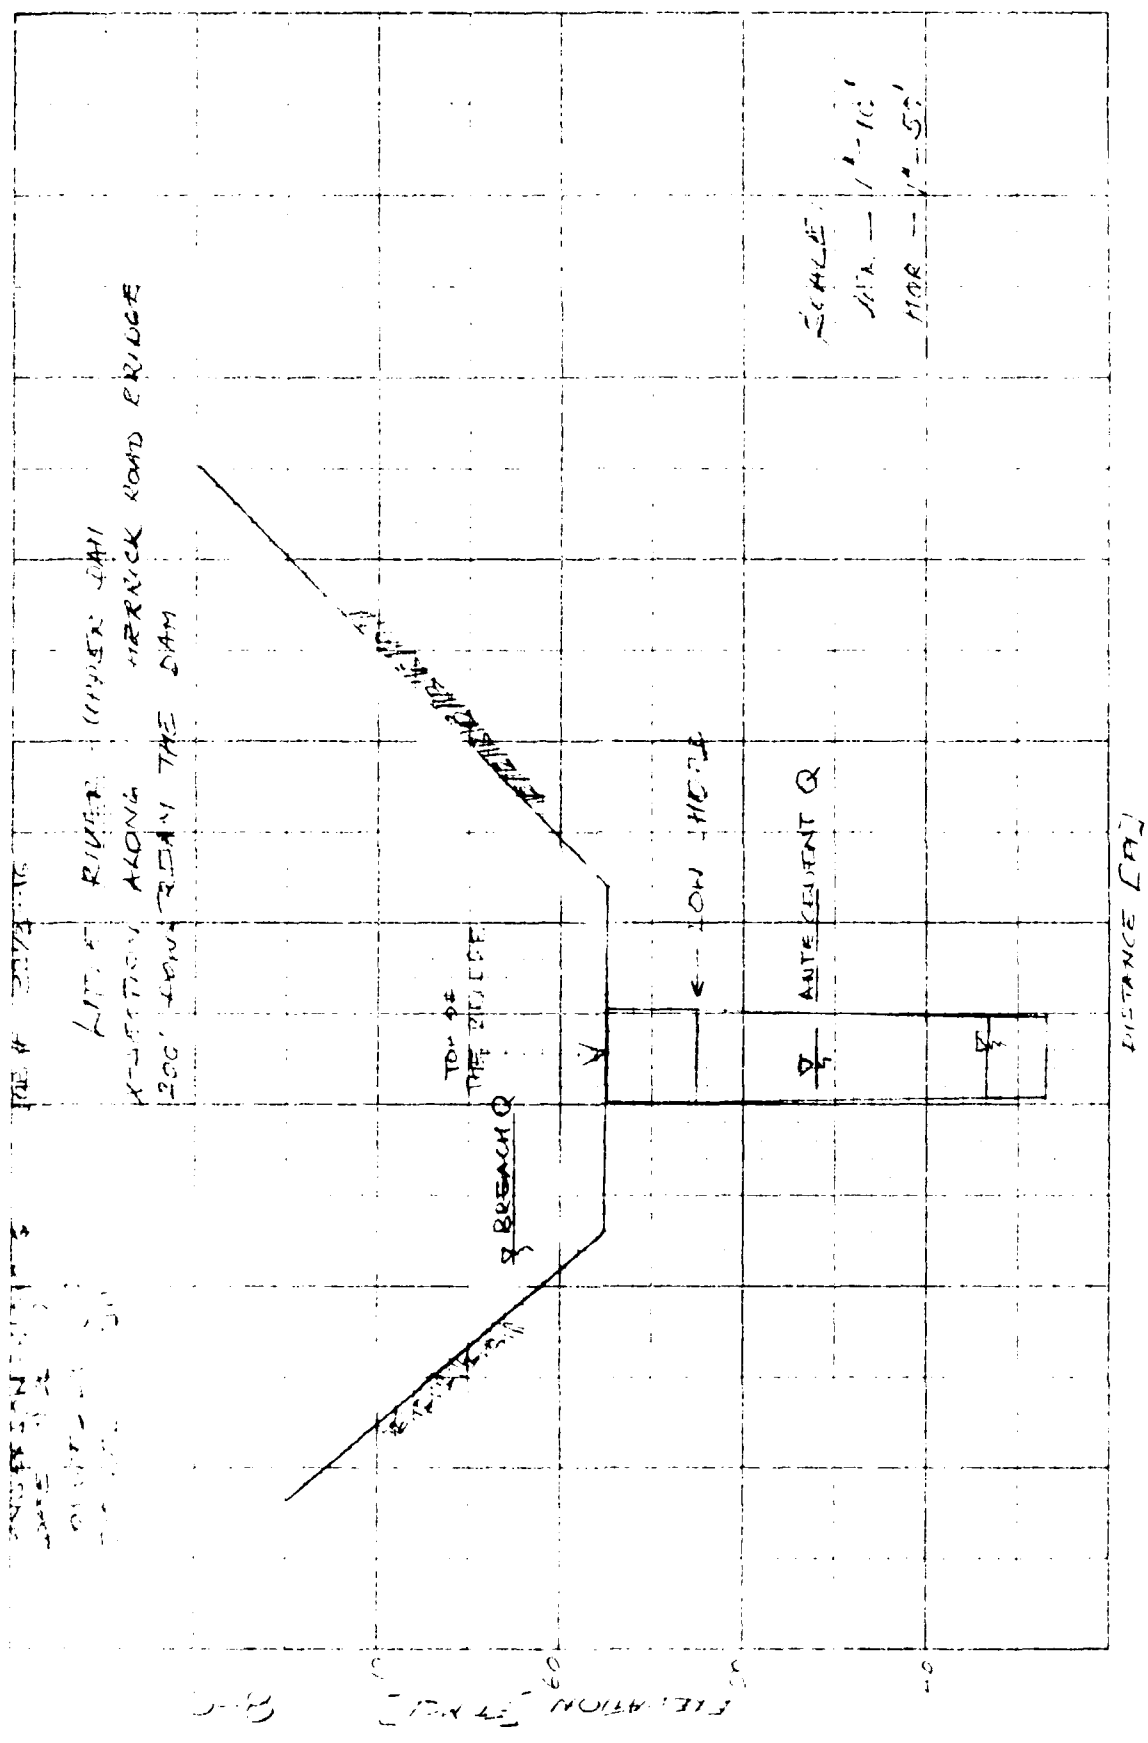

ANDERSON - NICHOLS, J. D.
 DATE 10-18-79
 COMPUTED BY J. D.
 CHECKED BY J. D.

WILHE RIVER - UPPER ARM
 DISCHARGE RATING CURVE AT THE HERRICK ROAD
 BRIDGE

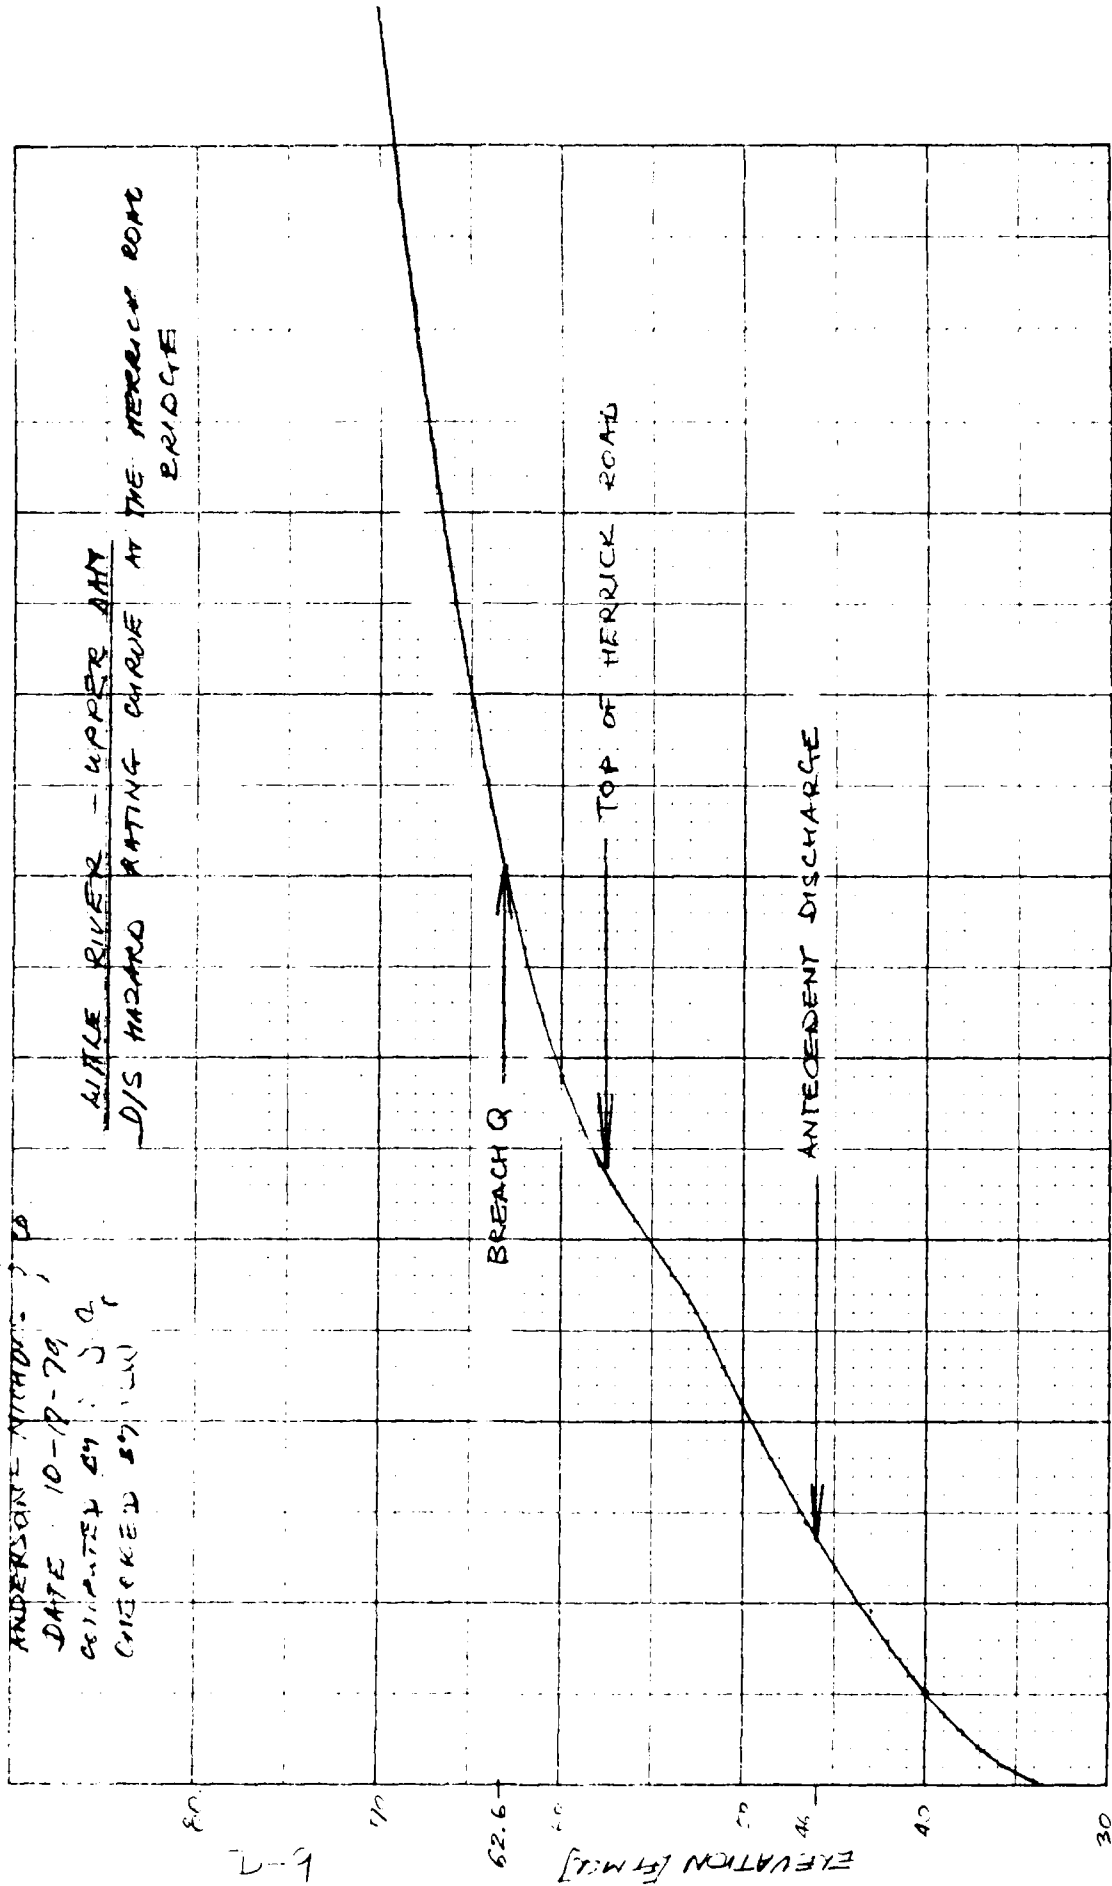

6-2

JOB NO. 2273-16JARES 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29
IN. SCALELITTLE RIVER - UPPER DAM


BREACH ANALYSIS - CONT'D

USE A TYPICAL CROSS SECTION ALONG THE DOWNSTREAM REACH
FROM THE HERRICK ROAD BRIDGE (200' BELOW THE DAM) TO CONFLUENCE
WITH RESERVOIR OF LOWER DAM AT A DISTANCE OF 1700 FT.
DEVELOP A RATING CURVE FOR THIS SECTION BY USE OF
MANNING'S EQUATION: $Q = \frac{1.49}{n} \cdot A \cdot R^{2/3} \cdot S^{1/2}$


$n = 0.06$

$S = 0.005$

DEPTH [FT]	AREA	WPER	Q [CFS]
0	0	0	0
4	239	71	933
8	556	92	3193
12	951	113	6794
16	1424	135	11862
20	1975	156	18542
24	2604	177	26976

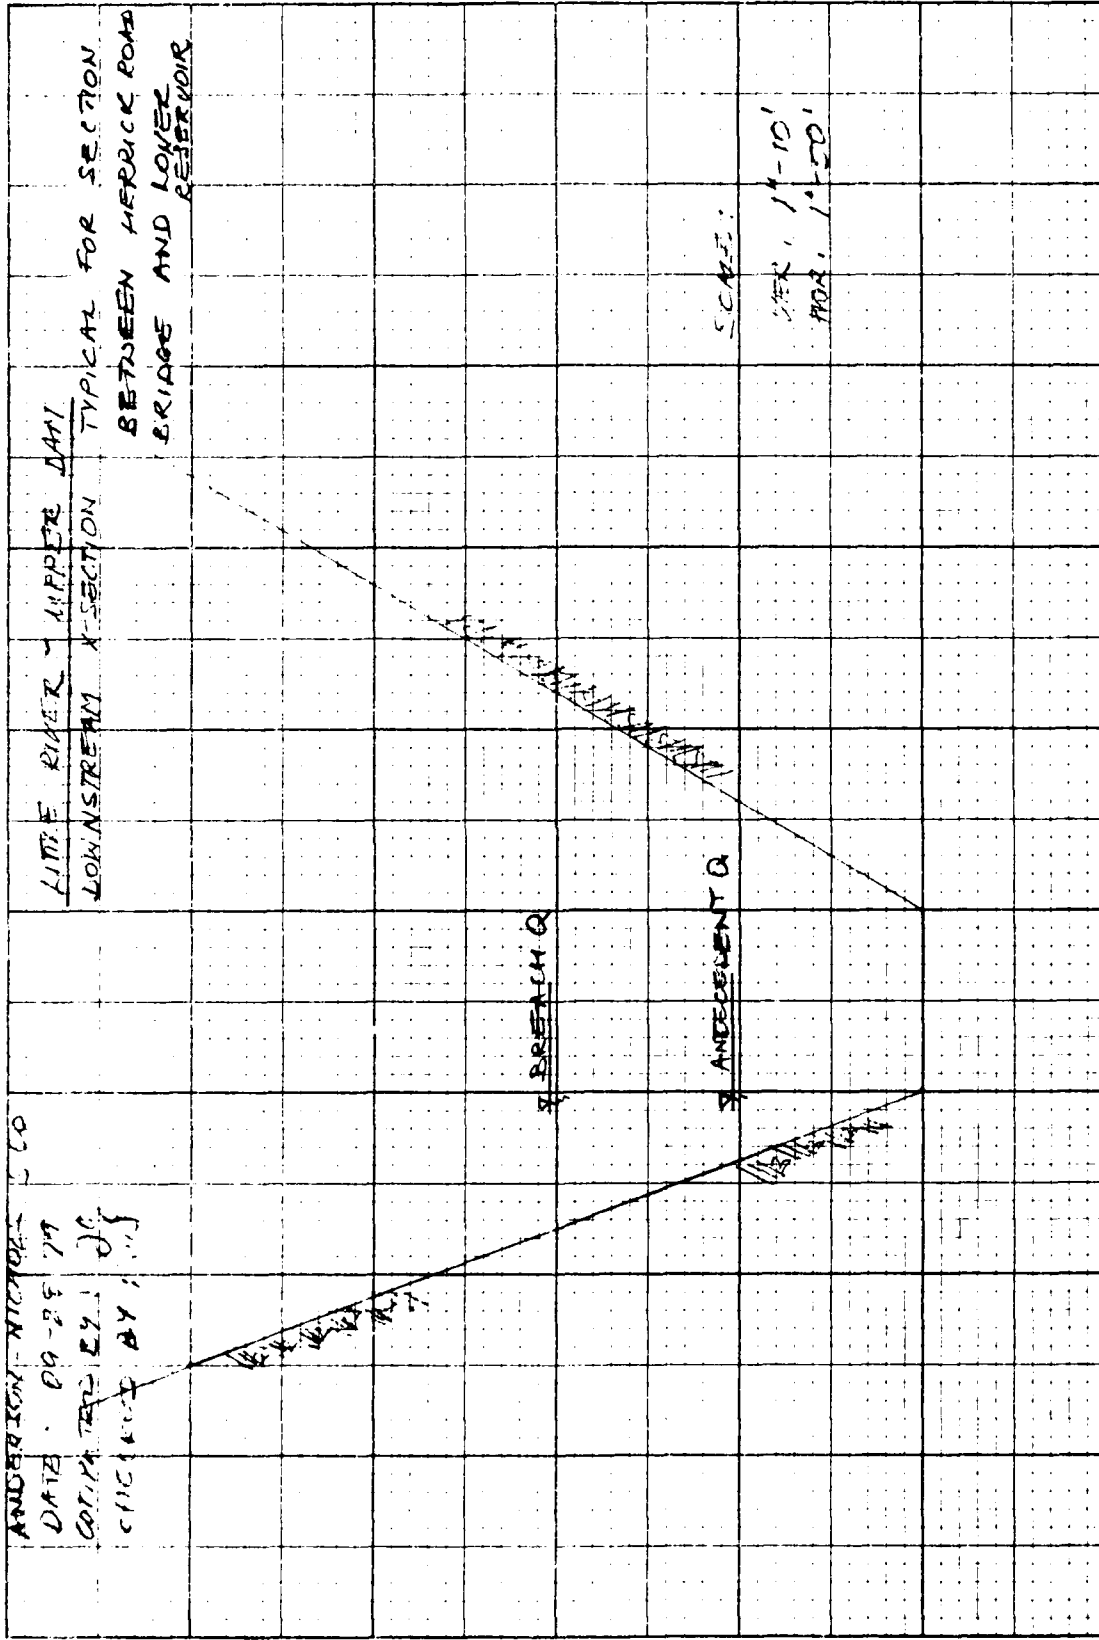

D-11

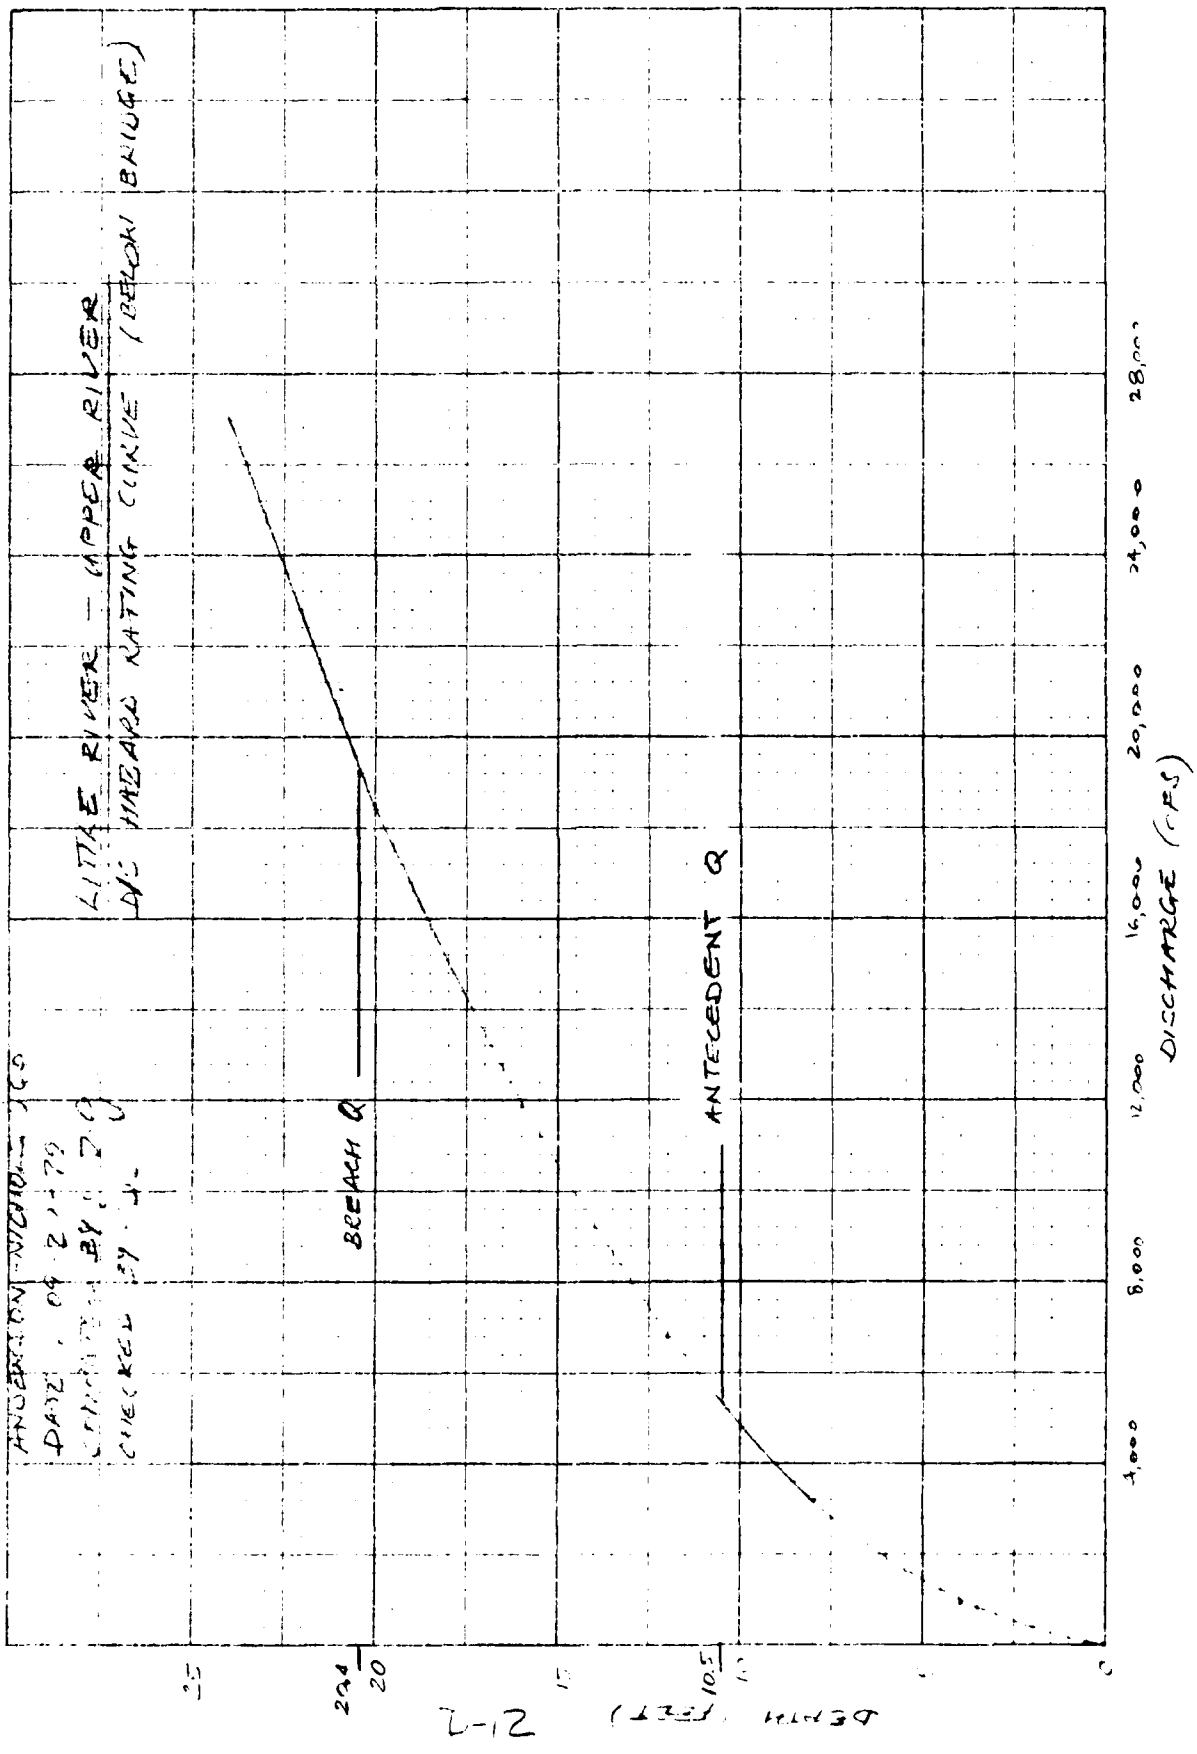

21-2
 DEPTH (FEET)
 DISCHARGE (CFS)

JOB NO. 3212 - 16LITTLE RIVER - UPPER DAMJARES 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29
N. SCALEBREACH ANALYSIS CONT'D

TO DETERMINE MAXIMUM RISE OF LOWER RESERVOIR
DUE TO BREACH OF UPPER RESERVOIR THE TOTAL
BREACH Q WILL BE APPLIED TO THE RATING CURVE
FOR THE LOWER DAM. THIS RESULTS IN AN ELEVATION
OF 38.6 FT MSL

CONCLUSIONS: A BREACH OF LITTLE RIVER UPPER
DAM COULD CAUSE OVERTOPPING AND POSSIBLE DAMAGE
TO THE HERRICK ROAD BRIDGE AND COULD ALSO CAUSE
OVERTOPPING OF LOWER RESERVOIR DAM.
THE BREACH COULD ALSO CAUSE LOSS OF A REGU-
-LATING RESERVOIR FOR USE IN WATER SUPPLY AND
THEREFORE POSES A HAZARD TO A PUBLIC UTILITY.
THERE WOULD PROBABLY BE NO LOSS OF LIFE BUT IT COULD
CAUSE APPRECIABLE PROPERTY DAMAGE. THEREFORE,
LITTLE RIVER UPPER DAM HAS BEEN CLASSIFIED AS
SIGNIFICANT HAZARD

JOB NO. 3273-16

JARES 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29
IN. SCALELITTLE RIVER UPPER DAM

DRAINAGE AREA — 13.7 SQ.MILE

SIZE CLASSIFICATION — SMALL

HAZARD CLASSIFICATION — SIGNIFICANT


TEST FLOOD RANGE $\frac{1}{4}$ PMF — $\frac{1}{2}$ PMF; CHOSEN $\frac{1}{2}$ PMF
BECAUSE THE SIZE OF DAM IS IN UPPER RANGE OF SIZE CLASSIFICATION.STEP #1 CALCULATE PMF USING "PRELIMINARY GUIDANCE
FOR ESTIMATING MAXIMUM PROBABLE DISCHARGES IN
PHASE I DAM SAFETY INVESTIGATIONS, MARCH 1978"SLOPE OF WATERSHED IS 125 ft/mi, THEREFORE THE
MOUNTAINOUS CURVE WILL BE USED.USE A C_{PM} VALUE OF 1870

$$13.7 \text{ SQ.MILE} \times 1870 \text{ CPM} = 25600 \text{ CFS}$$

$$\text{TEST FLOOD } (\frac{1}{2} \text{ PMF}) = 12,800 \text{ CFS (QPI)}$$

STEP #2A DETERMINE SURCHARGE HEIGHT TO PASS
Q_{PI} of 12,800 CFS. TO OBTAIN THIS, A DISCHARGE
RATING CURVE MUST BE CALCULATED FOR UPPER
RELEASING DAM. OUTFLOW WOULD OCCUR FIRST OVER
THE PRINCIPAL SPILLWAY. HIGHER FLOOD WATERS WILL
FLOW OVER THE DAM EMBANKMENTS AND SIDE SLOPES,
HOW THROUGH TWO OUTLET PIPES (6" AND 8" DIAMETER)
FROM VALVE CHAMBER IS INSIGNIFICANT. SIZE OF
EMERGENCY GATE IS UNKNOWN, GATE OPERATING MECHANISM
IS RUINED AND IN POOR CONDITION. THERE IS NO INDICATION
OF RECENT OPERATION. 18" TOP OUTLET PIPE FROM THE
GATE IS LIFTING ABOUT 30 INCH. BECAUSE OF ITS
CONDITION POSSIBLE FLOOD THROUGH EMERGENCY GATE
WILL NOT BE CALCULATED.

JDE # 3272-16

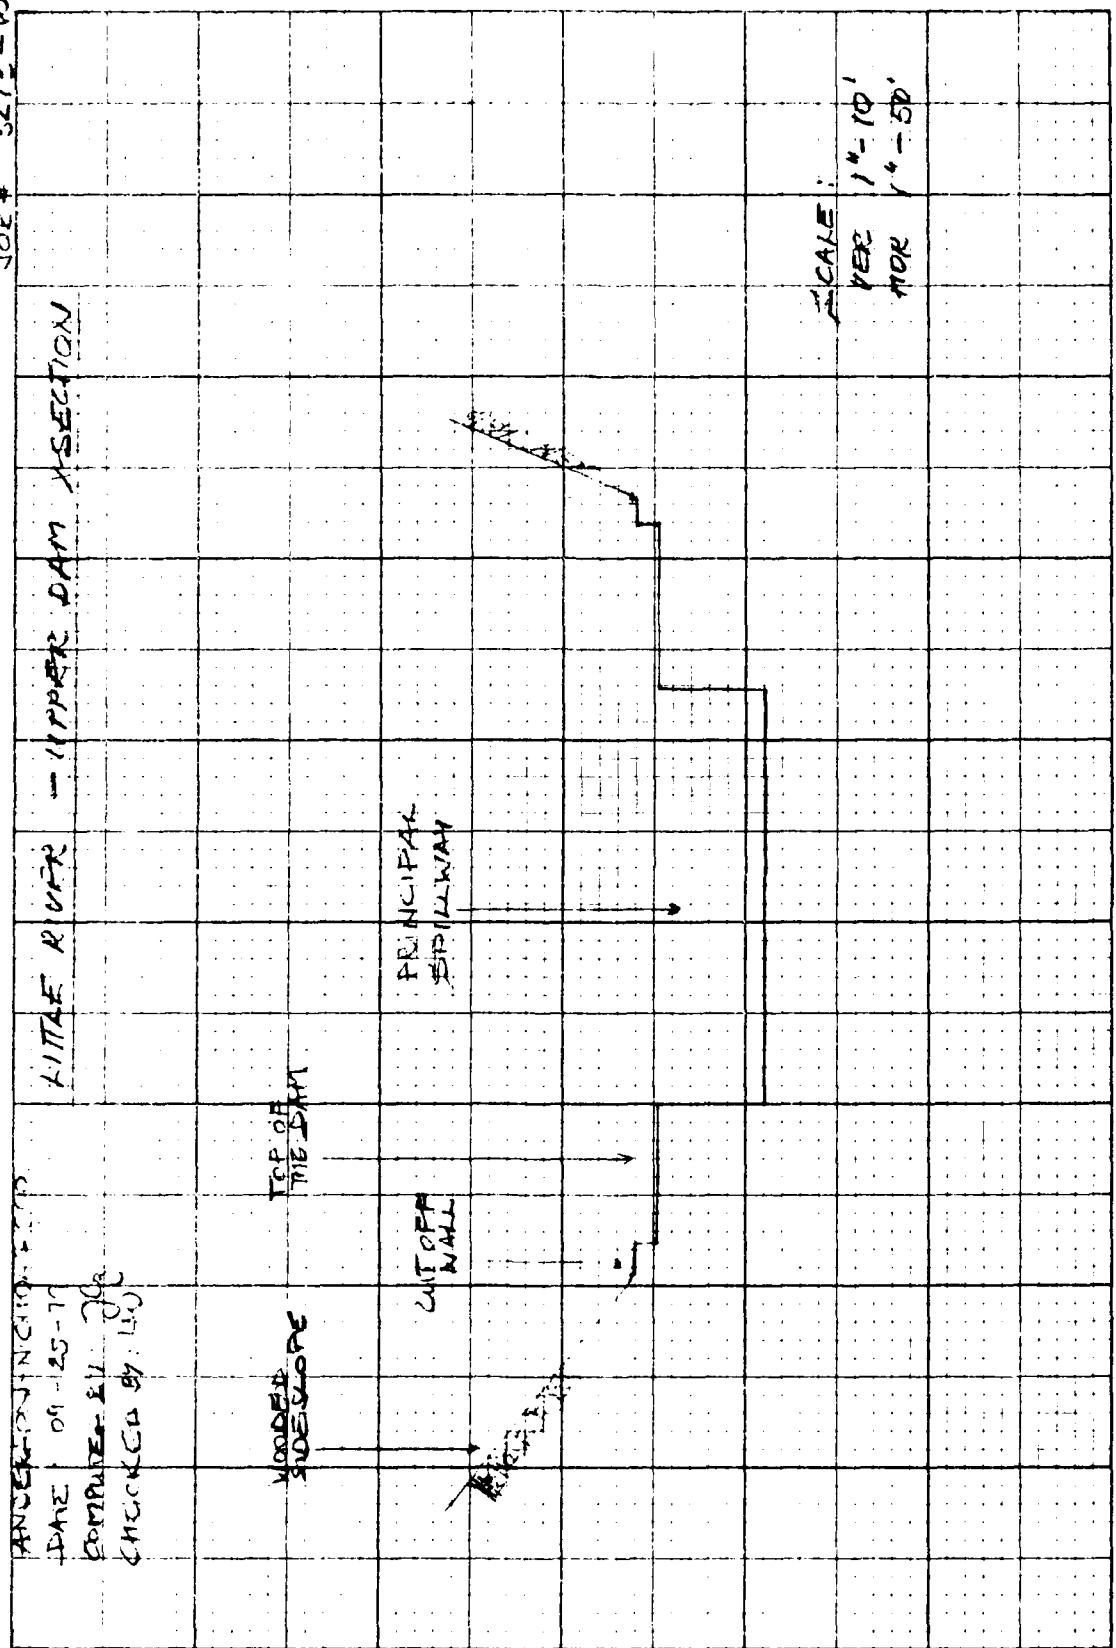

DISTANCE IN FEET

5-15

100

80

70

60

50

40

JOB NO. 1272-16

INCHES IN SCALE 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29

THE DATA OVER LAY - RATING CURVE CALCULATION


ELEV. (FEET)	FROM OVER THE SPILLWAY			FROM TOP OF LAY			FROM OVER THE SIDE SLOPES			TOTAL
	C. VALUE	L. (FEET)	H. (FEET)	C. VALUE	L. (FEET)	H. (FEET)	C. VALUE	L. (FEET)	H. (FEET)	
59	2.2	114	0							0
60			1							275
61			2							1065
62			3							1952
63			4							2010
64			5							4205
65			5.3							5290
66			7							5265
67			9				0.5	5	14	9410
68			10					10	29	1706
69			12					12	75	1451
70			14					14	25	1750
71			16					16	5	2012

TOP
CAN 649

D-16

ANDERSON NICHOLS & CO.
 DATE 10-02-79
 COMPILED BY J.E.G.
 CHECKED BY J.E.G.

LITTLE RIVER UPPER DAM
 - RATING CURVE

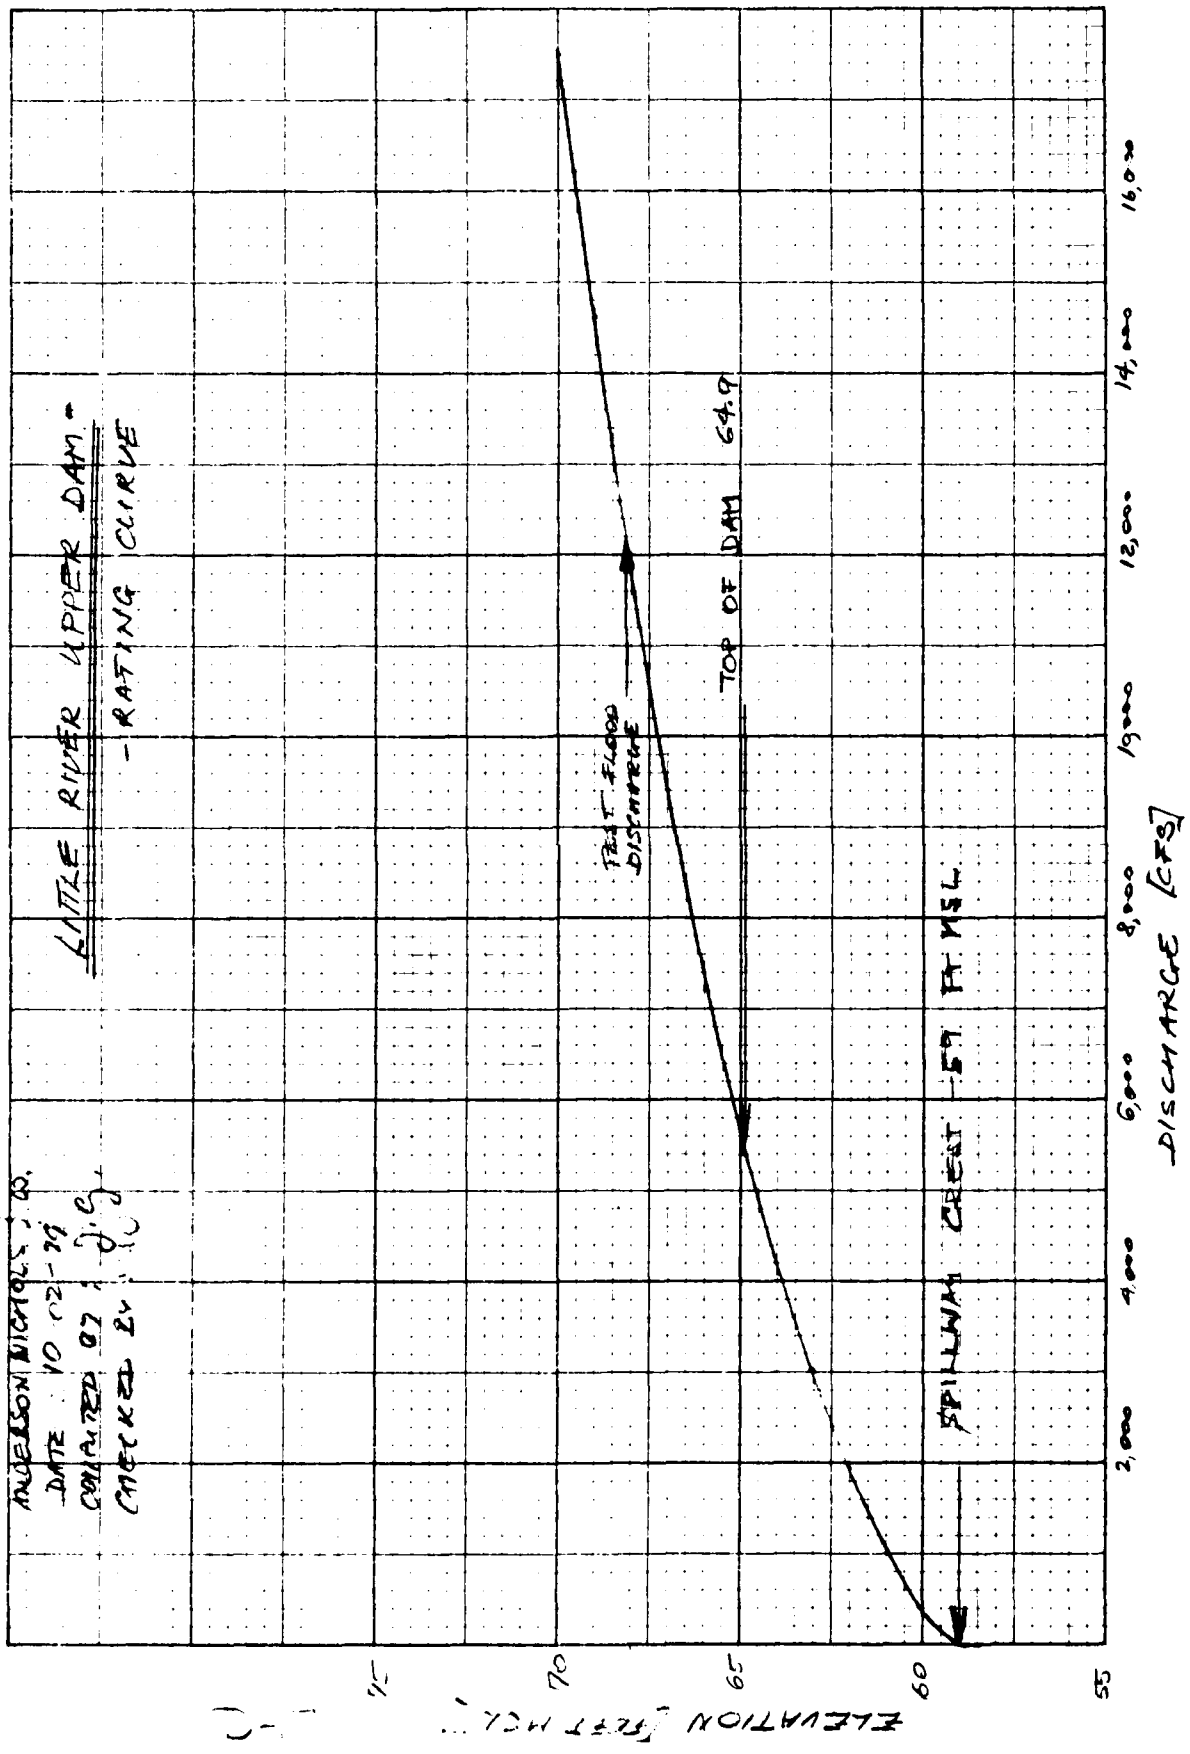

JOB NO. 3272 - 15
 AREAS
 IN. SCALE
WISSE RIVER - UPPER DAM

STORAGE - ELEVATION CURVE CALCULATIONS

NORMAL STORAGE (SPILLWAY CHEST - 59 FT MSL) - 480 AC-FT

NOTE: 480 AC-FT WAS OBTAINED BY ESTIMATING AVERAGE DEPTH
 OF RESERVOIR - 10 FT AND PLANIMETERED SURFACE OF
 RESERVOIR FROM QUAD SHEET - 48 AC. 157,000,000 GAL
 WISSE AC IMPOUNDING CAPACITY IN APPLICATION FOR
 DAM REGISTRATION (SEE PAGE) AGREES WITH THIS
 CALCULATION.

USING 'FRUSTUM OF PYRAMID EQUATION' AND PLANIMETERED
 SURFACE AREAS, DETERMINED POINTS FOR A STORAGE -
 ELEVATION CURVE

$$V = \frac{1}{3} h (b_1 + b_2 + \sqrt{b_1 b_2})$$

h - STEEP. ABOVE NORMAL

POOL

b₁ - NORMAL POOL SURFACEb₂ - ENLARGE POOL SURFACE

ELEV. 70. FT MSL


SURFACE AREA - 76 AC

$$V = \frac{1}{3} h (48 + 76 + \sqrt{48 \cdot 76}) = 676 \text{ AC-FT}$$

TOTAL STORAGE - 1156 AC-FT

ANDERSON - NICHOLS 3 CO.
DATE 1 10-16-76

LITTLE RIVER - UPPER DAM
— STORAGE - ELEVATION CURVE

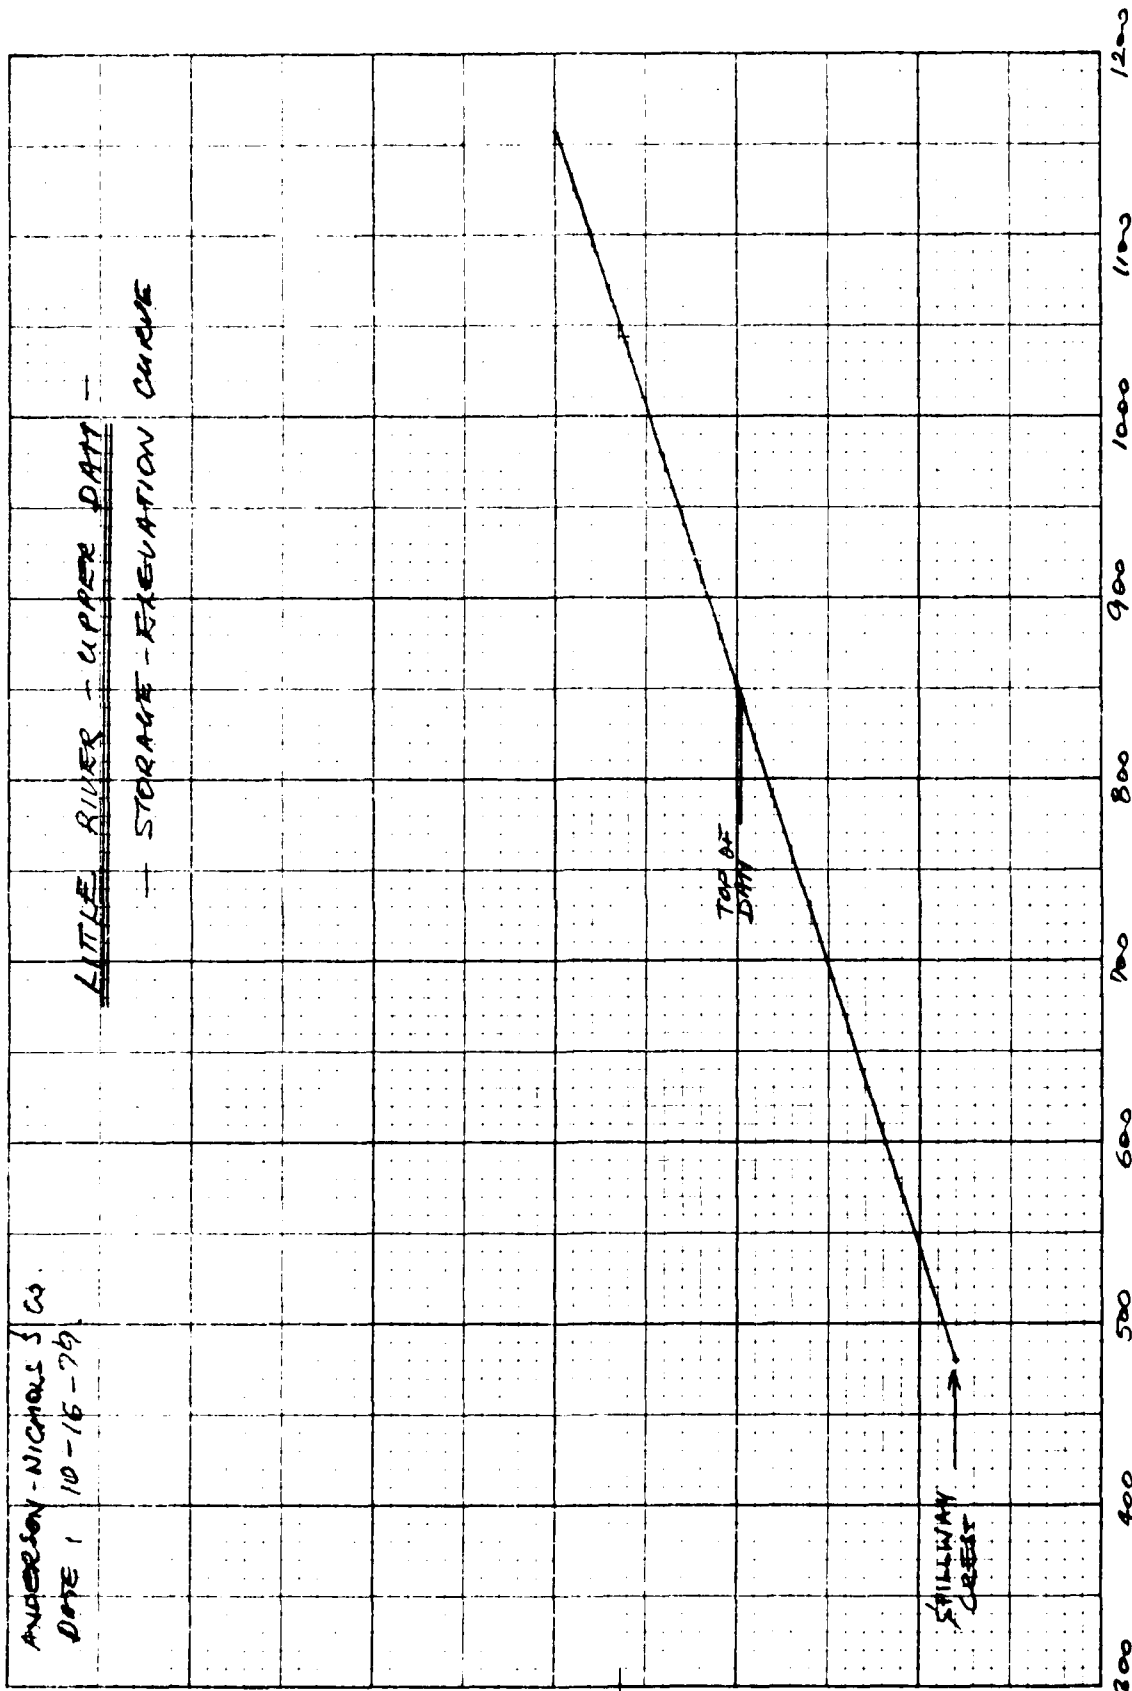

61-C

ELEVATION FT MSL

STORAGE [AL-FT]

JOB NO. 2242 16JAMES 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29
IN SCALELITTLE RIVER - UPPER DAMSTEP # 1 (CONT)

TEST FLOOD (1/2 PMF) = 12,800 CFS

ELEV @ 12,800 CFS \Rightarrow 68.4 FT MSLSTEP # 2DETERMINE VOLUME OF SURCHARGE IN INCHES
OF RUNOFF $Q_{p1} = 12,800 \text{ CFS} \rightarrow \text{ELEV. } 68.4 \text{ FT MSL}$ STORAGE AT 68.4 FT MSL \rightarrow 1050 AC-FTSTORAGE AT 59.0 FT MSL (SULLYWAY CREST) \rightarrow 480 AC-FT

$$570 \text{ AC-FT} \times \frac{1}{3.7 \text{ MI}} \times \frac{1 \text{ MI}^2}{640 \text{ AC}} \times 12 \frac{\text{IN}}{\text{FT}} = .78" \text{ RUNOFF} \quad (\text{STOR. 1})$$

STEP # 2 C

$$Q_{p2} = Q_{p1} \times \left(1 - \frac{\text{STOR. 1}}{9.5"}\right)$$

$$Q_{p2} = 12,800 \text{ CFS} \times \left(1 - \frac{.78"}{9.5"}\right) = 11,750 \text{ CFS}$$

STEP # 3DETERMINE SURCHARGE HEIGHT TO PASS Q_{p2} $Q_{p2} = 11,750 \text{ CFS} \rightarrow 68. \text{ FT MSL} \rightarrow 1035 \text{ AC-FT}$

$$555 \text{ AC-FT} \times \frac{1}{3.7 \text{ MI}} \times \frac{1 \text{ MI}^2}{640 \text{ AC}} \times 12 \frac{\text{IN}}{\text{FT}} = .76" \text{ RUNOFF}$$

7-20

JOB NO. 3273 - 16

SQUARES
IN. SCALE

0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29

LITTLE RIVER - UPPER DAMSTEP # 36AVERAGE $\frac{\text{STOR 1}}{1} \div \text{STOR 2}$

$$\frac{.78 + .76}{2} = .77 \text{ " RUNOFF}$$

$$.77 \times \frac{13.7 \text{ MI}^2}{1} \times \frac{640 \text{ AC}}{\text{MI}^2} \times \frac{\text{FT}}{12 \text{ IN}} = 563 \text{ AC-FT}$$

$$563 \text{ AC-FT} + 480 \text{ AC-FT} = 1043 \text{ AC-FT} \Rightarrow 68.2 \text{ FT-MSL}$$

TEST FLOOD — $\frac{1}{2}$ PMF

TEST FLOOD DISCHARGE — 12,200 CFS

TEST FLOOD ELEVATION — 68.2 FT-MSL

TOP OF DAM — 64.9 FT MSL THEREFORE DAM EMBANKMENT
WOULD BE OVERTOPPED BY ABOUT 3.3 FT DURING
TEST FLOOD CONDITIONS.

TOP OF DAM — 64.9 FT MSL \Rightarrow STORAGE 850 AC-FT

SPILLWAY CAPACITY @ TOP OF DAM IS 5390 CFS
WHICH IS 44 PERCENT OF THE TEST FLOOD DISCHARGE.

APPENDIX E

INFORMATION AS
CONTAINED IN THE NATIONAL
INVENTORY OF DAMS

DATE OF BIRTH: 1940-01-01
DATE OF DEATH: 1940-01-01
DATE OF BURIAL: 1940-01-01

DATE OF BIRTH: 1940-01-01
DATE OF DEATH: 1940-01-01
DATE OF BURIAL: 1940-01-01

200

3

100

1
2
3
4
5

100

Age Group	1970	1980	1990	2000	2010	2020
0-14	20	18	15	12	10	10
15-24	15	14	13	12	11	10
25-34	12	11	10	9	8	7
35-44	10	9	8	7	6	5
45-54	8	7	6	5	4	3
55-64	6	5	4	3	2	1
65-74	4	3	2	1	0	0
75+	5	6	7	8	10	20

Yin-Yang

END

FILMED

7-85

DTIC